



HIPOT Tester 19071/19072/19073 User's Manual

Version 1.8
March 2007
P/N A11 000787

Legal Notices

The information in this document is subject to change without notice.

Chroma ATE INC. makes no warranty of any kind with regard to this manual, including, but not limited to, the implied warranties of merchantability and fitness for a particular purpose. Chroma ATE INC. shall not be held liable for errors contained herein or direct, indirect, special, incidental or consequential damages in connection with the furnishing, performance, or use of this material.

CHROMA ATE INC.

No. 66 Hwa-Ya 1st Rd., Hwa-Ya Technical Park, Kuei-Shan Hsiang, Taoyuan Hsien,
Taiwan

Copyright Notices. Copyright 2003 - 2007 Chroma ATE INC., all rights reserved.
Reproduction, adaptation, or translation of this document without prior written permission is prohibited, except as allowed under the copyright laws.

Warranty

All Chroma instruments are warranted against defects in material and workmanship for a period of one year after date of shipment. Chroma agrees to repair or replace any assembly or component found to be defective, under normal use during this period. Chroma's obligation under this warranty is limited solely to repairing any such instrument, which in Chroma's sole opinion proves to be defective within the scope of the warranty when returned to the factory or to an authorized service center. Transportation to the factory or service center is to be prepaid by purchaser. Shipment should not be made without prior authorization by Chroma.

This warranty does not apply to any products repaired or altered by persons not authorized by Chroma, or not in accordance with instructions furnished by Chroma. If the instrument is defective as a result of misuse, improper repair, or abnormal conditions or operations, repairs will be billed at cost.

Chroma assumes no responsibility for its product being used in a hazardous or dangerous manner either alone or in conjunction with other equipment. High voltage used in some instruments may be dangerous if misused. Special disclaimers apply to these instruments. Chroma assumes no liability for secondary charges or consequential damages and in any event, Chroma's liability for breach of warranty under any contract or otherwise, shall not exceed the purchase price of the specific instrument shipped and against which a claim is made.

Any recommendations made by Chroma for use of its products are based upon tests believed to be reliable, but Chroma makes no warranty of the results to be obtained. This warranty is in lieu of all other warranties, expressed or implied, and no representative or person is authorized to represent or assume for Chroma any liability in connection with the sale of our products other than set forth herein.

CHROMA ATE INC.

No. 66 Hwa-Ya 1st Rd, Hwa-Ya Technical Park,
Kuei-Shan Hsiang, Taoyuan Hsien, Taiwan
Tel: 886-3-327-9999
Fax: 886-3-327-2886
<http://www.chromaate.com>

Material Contents Declaration

A regulatory requirement of The People's Republic of China defined by specification SJ/T 11364-2006 mandates that manufacturers provide material contents declaration of electronic products, and for Chroma products are as below:

Part Name	Hazardous Substances					
	Lead	Mercury	Cadmium	Hexavalent Chromium	Polybrominated Biphenyls	Polybromodiphenyl Ethers
	Pb	Hg	Cd	Cr ⁶⁺	PBB	PBDE
PCBA	×	O	O	O	O	O
CHASSIS	×	O	O	O	O	O
ACCESSORY	×	O	O	O	O	O
PACKAGE	O	O	O	O	O	O
<p>“O” indicates that the level of the specified chemical substance is less than the threshold level specified in the standards of SJ/T-11363-2006 and EU 2005/618/EC.</p> <p>“×” indicates that the level of the specified chemical substance exceeds the threshold level specified in the standards of SJ/T-11363-2006 and EU 2005/618/EC.</p> <ol style="list-style-type: none"> 1. Chroma is not fully transitioned to lead-free solder assembly at this moment; however, most of the components used are RoHS compliant. 2. The environment-friendly usage period of the product is assumed under the operating environment specified in each product's specification. 						

Disposal

Do not dispose of electrical appliances as unsorted municipal waste, use separate collection facilities. Contact your local government for information regarding the collection systems available. If electrical appliances are disposed of in landfills or dumps, hazardous substances can leak into the groundwater and get into the food chain, damaging your health and well-being. When replacing old appliances with new one, the retailer is legally obligated to take back your old appliances for disposal at least for free of charge.





Corporation
Quietek

EMC/Safety Test Laboratory
Accredited by DNV, TUV, Nemko and NVLAP

Date: December 28, 2001
QTK No.: 01CL036E



Statement of Conformity

The certifies that the following designated product

Product : Hipot tester
Trade name : Chroma; TOADKK
Model Number : 19071/19072/19073(Chroma)
WT-8771/WT-8772/WT-8773(TOADKK)
Company Name : CHROMA ATE INC.

This product is herewith confirmed to comply with the requirements set out in the Council Directive on the Approximation of the laws of the Member States relating to Electromagnetic Compatibility Directive (89/336/EEC). For the evaluation regarding EMC, the following standards were applied:

RFI Emission:

EN 61326:1997 Class A : Product Family standard
Amendment 1: 1998

EN 61000-3-2:1995 Class D : Limits for harmonic current emission
Amendment 1:1998
Amendment 2:1998


EN 61000-3-3:1995 : Limitation of voltage fluctuation and flicker in low-voltage supply system

Immunity :

EN 61326:1997 : Product Family standard



 TEST LABORATORY


Gene Chang / Manager

The verification is based on a single evaluation of one sample of above-mentioned products. It does not imply an assessment of the whole production and does not permit the use of the test lab. Logo.

***** The Danger of Operating *****

1. When the instrument is under output voltage, please don't touch test area or you may shock hazard and result in death.

Please obey the following items.

- Make sure the grounding cable is connected correctly and using the standard power cord.
 - Don't touch the output terminal.
 - Don't touch test cable of connecting test termination.
 - Don't touch test termination object.
 - Don't touch any charge component of connecting output terminal.
 - As the instrument end the test or turn off output, please don't touch test unit immediately.
2. The shock accidents are usually occurred on the following conditions.
 - The grounding terminal of the instrument doesn't connect correctly.
 - No use insulation glove for testing.
 - After test is completed to touch test unit immediately.
 3. Remote control for the instrument: This instrument provided with remote control, normally using the external signal to control high voltage output. For safety reasons and prevent from hazards, please exactly follow instructions below while using remote control.
 - Unexpected high voltage output may exist. Make sure if this instrument is under testing/remote controlling before access to the probes.
 - When the instrument is under testing/operating, any access to DUT, test cable and probe output terminal are prohibited, both for the operator/service personnel.
 - Normally remote control of this instrument is controlled by the high voltage test bar. However, using of other control circuit is also possible. For safety reasons and prevent from hazards, please notice that unintentional access to the control test bar or bridging the control circuit to high voltage terminal and test cables may cause hazards. Please keep this terminal/control from unintentional bridging/access to avoid danger.

※※※ Storage. Freight. Maintenance ※※※

Storage

When don't use the device, please pack it properly and store under a good environment.
(The packing is no needed when the device under appropriate environment.)

Freight

Please use the original packing material when move the device. If the packing material is missing, please use the equivalent buffer material to pack and mark it fragile and waterproof etc to avoid the device damage during movement. The device belongs to precise equipment, please uses qualified transportation as possible. And avoid heavy hitting etc to damage the device.

Maintenance

There is no maintenance operation for the general user. (Except for the note in the manual.) Please contact our company or agent when the device occurred the user judgment abnormal. Don't maintain by yourself to avoid occurred unnecessary danger and serious damage to the device.

Revision History

The following lists the additions, deletions and modifications in this manual at each revision.

Date	Version	Revised Sections
Jan. 2003	1.0	Complete this manual.
April 2003	1.1	Modify "Specifications (18°C ~ 28°C RH ≤ 70%)" "Standard Accessory" "Rear Panel" "RS-485 Interface" "Solving Problems"
Dec. 2003	1.2	Modify "Introduction" "Rear Panel" "Operation" "Auto Range" "Calibration Procedure" "Command Description" Delete "RS-485 Interface" Add "RS485 Interface (Optional)"
March 2004	1.3	Add "The Danger of Operating" "Storage. Freight. Maintenance. Disposal" Modify "Specifications (18°C ~ 28°C RH ≤ 70%)" "Rear Panel"
Sep. 2004	1.4	Modify "Product Features" "Optional Accessory" "Rear Panel" "PROGRAM Parameter Setting" "How to Perform Tests" "RS485 Interface (Option)"
March 2005	1.5	Modify "Introduction" "System Setup" "PROGRAM Parameter Setting" "How to Perform Tests" "KEY LOCK Function" "Command List" "Command Description"
Aug. 2006	1.6	- Add " <i>CE Statement of Conformity</i> " - Add the description of " <i>Power Cord (W12 030080)</i> " to the section of "Standard Accessory" - Add the section of " <i>Initial Inspection</i> "

- Nov. 2006 1.7
- Modify the description of Disposal in “*Storage, Freight, Maintenance & Disposal*”
 - Modify the descriptions of RS-485 command in the section of “*Command Description*”.
- March 2007 1.8
- Add “*Material Contents Declaration*”
- Delete the description of Disposal in “*Storage, Freight, Maintenance & Disposal*”

Table of Contents

1.	Introduction	1-1
1.1	An Overview of Function.....	1-1
1.2	Product Features	1-1
1.3	Specifications (18°C ~ 28°C RH ≤ 70%)	1-3
1.4	Standard Accessory	1-5
1.5	Optional Accessory	1-5
1.6	Initial Inspection.....	1-5
2.	Operation and Setting.....	2-1
2.1	Front Panel	2-1
2.1.1	Display Area	2-1
2.1.2	Button Area	2-2
2.1.3	Terminal Area	2-2
2.2	Rear Panel	2-3
2.3	Operation.....	2-6
2.3.1	Memory Process.....	2-6
2.3.2	System Setup	2-7
2.3.3	PRESET Parameter Setting.....	2-8
2.3.4	PROGRAM Parameter Setting.....	2-9
2.4	How to Perform Tests	2-12
2.5	Other User Setting Function.....	2-16
2.5.1	KEY LOCK Function.....	2-16
2.5.2	Auto Range.....	2-17
2.5.3	Change User Password.....	2-17
2.5.4	Remote Control	2-18
2.5.5	Output Signal	2-19
3.	Installation and Maintenance.....	3-1
3.1	Notices for Installation	3-1
3.1.1	Charging During DC HiPot/Insulation Resistance Test	3-2
3.1.2	Emergency Events.....	3-3
3.1.3	Solving Problems	3-3
3.2	Notices for Maintenance	3-5
3.3	Troubleshooting.....	3-6
3.4	Input/Output Pin Assignment	3-6
4.	Calibration Procedure	4-1
4.1	Calibration.....	4-2
4.2	Voltage Calibration.....	4-2
4.2.1	Connection Diagram	4-2
4.2.2	ACV Calibration (AC Mode).....	4-2
4.2.3	DCV Calibration (DC/IR MODE)	4-3
4.2.4	IRV Calibration (DC/IR Mode).....	4-4
4.3	Current Calibration.....	4-5
4.3.1	Connection Diagram	4-5
4.3.2	ACA Calibration (AC MODE).....	4-5
4.3.3	DCA Calibration (DC/IR MODE).....	4-7
4.4	ARC Calibration.....	4-8
4.4.1	Connection Diagram	4-8
4.4.2	AC ARC Calibration (AC MODE)	4-9

4.4.3	DC ARC Calibration (DC MODE)	4-9
4.5	IRR Calibration (IR Mode)	4-10
4.5.1	Connection Diagram	4-10
4.5.2	Insulation Resistance Calibration.....	4-10
4.6	Ground Continue Calibration.....	4-12
4.6.1	Connection Diagram	4-12
4.6.2	Description of Ground Continue Calibration	4-12
4.7	LCD Contrast Calibration	4-13
4.8	Complete Calibration	4-14
5.	RS485 Interface (For Link Model of 19073 + RS485)	5-1
5.1	Description of Function.....	5-1
5.2	Parameter Setting	5-1
5.3	Terminal and Pin Signal Connection.....	5-2
5.4	Communication Protocol.....	5-3
5.5	Command List.....	5-4
5.6	Command Description.....	5-4
5.7	Flow Diagram.....	5-25
6.	Maintenance.....	6-1
6.1	General	6-1
6.2	Instrument Return.....	6-1

1. Introduction

1.1 An Overview of Function

- This high quality automatic HiPot test instrument is designed to test the withstanding leakage current and insulation resistance for electric machinery and electronic devices.
- For withstanding test, its output power is AC: 100VA (5kV, 20mA), DC: 30VA (6KV, 5mA), which is applicable to electronic, electric machinery and components for withstanding and insulation tests.
- For insulation resistance, its test range is from 0.1M Ω ~50G Ω , and test voltage is 0.050kV~1kV definable.
- For ground continue, its test range is from 0 Ω ~5 Ω .
- For short/open detection, before testing high voltage test if the capacitance is short or open circuit in advance. For ensure the DUT is good contact then to perform high voltage test.
- All settings for state, time, current, voltage and resistance can be seen clearly on the display. There is no need to memorize the parameter state of any items.
- It is equipped with devices for Pass/Fail judgment, test results and remote control.
- It can perform high efficiency and accurate tests for electric machinery, electronic devices and components.

1.2 Product Features

■ Multiple Test States

This instrument can select a single item for test, such as AC withstanding test, DC withstanding test, insulation resistance test, ground continue test and short/open detection test.

■ Clear Display

This instrument has the clearest design for setting the parameters of test voltage, current states, readings, procedures and states. All of them can be read from the display directly.

■ High/Low Limit Comparator for Pass/Fail Judgment

The function of high/low limit comparator for Pass/Fail judgment is designed for both withstanding and insulation resistance test. The HiPot low limit comparator and insulation high limit comparator are generally designed to prevent the misjudgment due to bad connection or test cable tripped. This function is able to detect if there is any bad connection or broken line.

- **Remote Control**

This instrument can extend [START] and [RESET] signals to control externally. Usually they are connected to high voltage test gun or control case.

- **Changing the Time for Voltage Rising**

This instrument contains [RAMP] function. This function is to change the time required for the outputted test voltage from zero rising to the specified value.

- **Changing the Time for Voltage Falling**

This instrument contains [FALL] function. This function is to change the time required for the outputted test voltage from the specified value falling to zero.

- **Current Range Auto Switch**

There are two HiPot test AC ranges, one is low AC range 0 ~ 3.000mA, the other is AC 3.01~20mA. There are three DC ranges, low current range 0 ~ 300uA, current range 0.301mA ~ 3mA and current range 3.01mA ~ 5.00mA. When the testing current is small, you can set if to switch the current range to the low one automatically for higher resolution via software as need.

- **RS-485 Interface Multi-Link Test (For link test model of 19073 + RS485 only)**

The tester and PC that installed RS485 interface card performs link test. The maximum is 31 sets of instruments to process link test with PC mainframe simultaneously. Also, PC mainframe can control the setting and read the test data. When there is no PC mainframe, multi-link test can be performed individually but the test data can't be read.

1.3 Specifications (18°C ~ 28°C RH ≤ 70%)

Withstanding Voltage Test	
Test Voltage	AC: 0.05~5kV / DC: 0.05~6kV Constant Voltage (19072, 19073 only)
Voltage Regulation	≤ 1%+5V, Rated Load
V-display Accuracy	± (1% of reading + 5 counts), 2V resolution
Cutoff Current (Note1)	AC: 0.1mA ~ 20mA, DC: 0.01mA ~ 5mA (Note1), 0.1uAdc resolution
I-display Accuracy 0.1uA-299.9uA 0.3mA-2.999mA 3mA-20mA(5mAdc)	± (1.5% of reading + 5 counts) (Note2) WDC only ± (1.5% of reading + 5 counts) (Note2)
Output Frequency	50Hz, 60Hz
Test Time	0.1 ~ 999 Sec, continue (Note3)
Dwell Time	0.1 ~ 999 Sec, off
Ramp Time	0.1 ~ 999 Sec, off (0.1sec approx.)
Fall Time	0.1 ~ 999 Sec, off
Arc Detection	
Setting Mode	Programmable Setting
Detection Current	AC: 1mA ~ 20mA, DC: 1mA ~ 5mA
Min. pulse width	10us approx.
GOOD/NO-GO Judgment Function	
Judgment System	<ul style="list-style-type: none"> Window comparator A NO-GO judgment is made when a current greater than the high limit value or smaller than the low limit value is detected. When a NO-GO judgment is made, the output voltage is cut out and a NO-GO alarm signal is delivered. If no abnormal state is detected during the test time a GOOD Judgment is made and a GOOD signal is delivered.
Insulation Resistance Test (19073 only)	
Test Voltage	DC: 0.05kV ~ 1kV, Constant Voltage
V-display Accuracy	± (5% of reading + 5 counts) (open voltage), 2V resolution
Resistance Range	0.1 MΩ ~ 50 GΩ (Note 4)
Measuring Accuracy	≥ 500V: 1MΩ ~ 1000MΩ: ± 4% + 5 counts 1GΩ ~ 10GΩ: ± 7% + 5 counts 10GΩ ~ 50GΩ: ± 12% + 5 counts < 500V: 0.1 MΩ ~ 1000MΩ: ± 7% + 5 counts < 100V: 0.1 MΩ ~ 1000MΩ: ± 10% + 5 counts
Secure Protection Function	
Fast Output Cut-off	Approx. 0.4mS, after NG happen
Fast Discharge	Approx. 0.2S, Typical
Ground Fault Interrupt	0.5mA ± 0.25mAac (ON), OFF
Continuity Check	0.1Ω ~ 5.0Ω ± 0.2Ω, GC MODE
Panel Operation Lock	YES
Memory Storage	
Memories, Steps	10 steps or 60 groups for total 60 memory location
GO/NG Judgment Window	

□ Indication, Alarm	GO: (Short Sound) NG: W-Arc, W-Hi, W-Lo, IR-Lo, IR-Hi, GFI (Long Sound)
□ Remote Connector	
□ Rear Panel 9 Pin D-type Connector	Input: Start, Stop, Interrupt Output: Under test, Pass, Fail
□ TEST/RESET Control	Low - active control (24V open voltage typical). Input requirements: <ul style="list-style-type: none"> • Input time duration: 20msec. approx The above input circuits are not isolated from other internal circuits.
□ Options (RS485 only)	
□ RS-485 Interface	A maximum of 32 devices connected to each bus
□ Ambient Temperature and Relative Humidity	
□ Specifications range	18 to 28°C (64 to 82°F), ≤ 70% RH.
□ Operable range	Maximum relative humidity 80% for temperature up to 31°C (88°F). Decreasing linearly to 50% relative humidity at 40°C (104°F)
□ Storage range	-10 to 60°C (-14 to 140°F), ≤ 80% RH.
□ Power Requirement	
□ Line Voltage	AC 100V, 120V, 220V ± 10%, 240V +5 -10%
□ Frequency	50 or 60 Hz
□ Power	No load: < 60W
□ Consumption	With rated load: 300W max.
□ General	
□ Dimension	270(W) x 105(H) x 350(D) mm
□ Weight	Approx 12kg
□ Safety	
□ Ground Bond	Less than 100mΩ at 25Amp, 3sec
□ Hipot	Less than 10mA at 1.8kVac, 3sec
□ Insulation Resistance	Over 100MΩ at 500V 3sec
□ Line leakage current	Less than 3.5mA at 127V, 3sec, normal, reverse

Note 1: AC set over 75VA, DC set over 22.5VA the maximum operating time is 60 seconds, and the same as rest time.

If period of rest time is 1/2 duty of operating time. For full rating output, the line input range is +10% ~ -0%.

Note 2: Only refer to 1.2kV resistance load.

Note 3: IR test time range is 0.3 sec ~ 999 sec.

Note 4: Display resistance range is up to 60GΩ.

1.4 Standard Accessory

Item	Part Number	Q'ty	Description
Power Cord	W12 010130	1	Line cord
Power Cord	W12 030080	1	Line cord for TUV
3P – 2P Adapter	N31 000039	1	Power cord adapter
Test Cable (1)	W38 001940	1	Withstanding test cable for HIGH terminal
Test Cable (2)	W38 001760	1	Withstanding test cable for LOW terminal
Test Cable (3)	W38 001930	1	Ground continuity test cable
Fuse (1)	A21 020400	2	3.15A SLOW for 110VAC
Fuse (2)	A21 018300	2	1.6A SLOW for 240VAC

1.5 Optional Accessory

Item	Part Number	Q'ty	Description
RJ-45 twin head link cable	W39 000695	1	L: 450mm
RJ-45 twin head link cable	W38 029300	1	L: 1000mm
RJ-45 twin head link cable	W39 000694	1	L: 2000mm
RJ-45 twin head link cable	W38 029200	1	L: 4000mm
DB-9F single head link cable	W39 000771	1	L: 7000mm
Across HV head + HV cable	W25 000045	1	L: 2000mm
Black banana head + HV cable	W25 000046	1	L: 2000mm

Remark: Optional accessory is for link test model of 19073 + RS485 only.


1.6 Initial Inspection

Before shipment, this instrument was inspected and found to be free of mechanical and electrical defects. As soon as the instrument is unpacked, inspect for any damage that may have occurred in transit. Save all packing materials in case that the instrument has to be returned. If damage is found, please file claim with carrier immediately. Do not return the instrument to Chroma without prior approval.

2. Operation and Setting

2.1 Front Panel

The front panel is divided into several function areas. This section explains each control and the information displays on LCD.

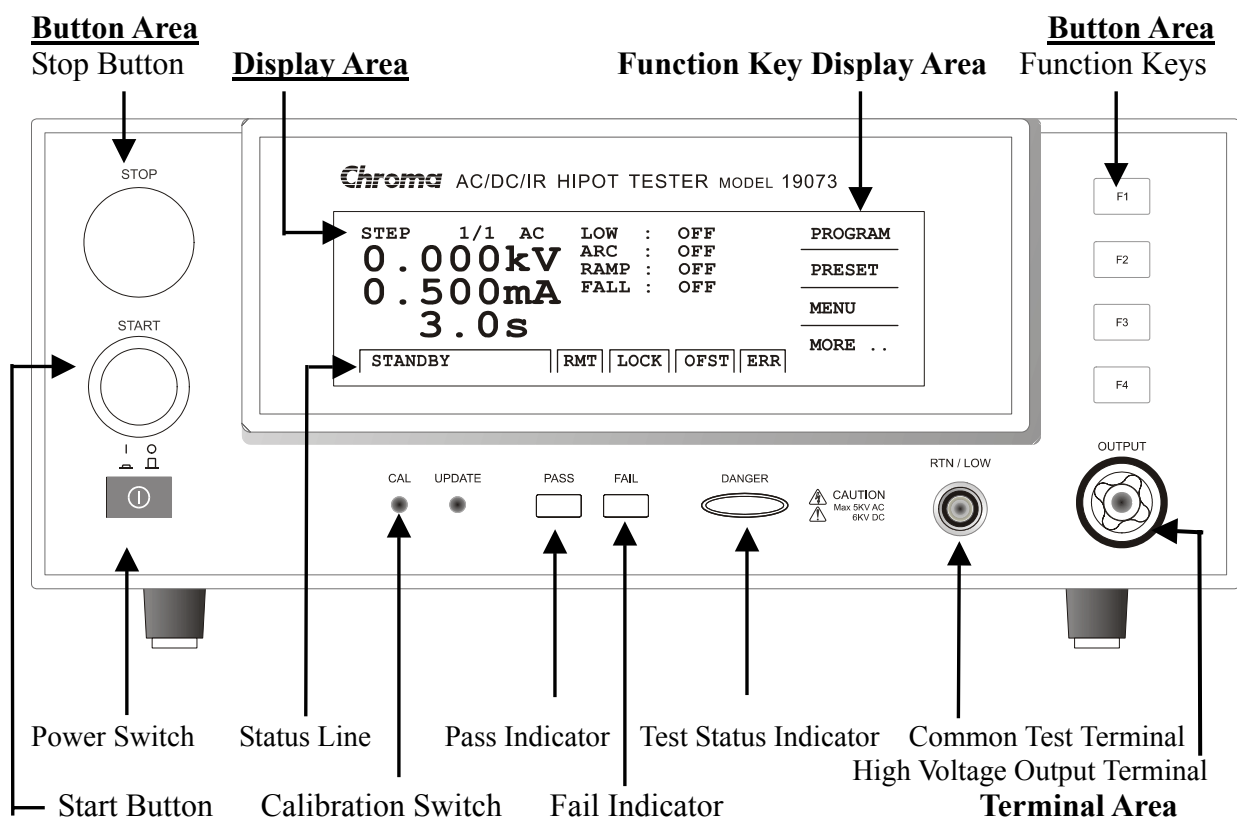

2.1.1 Display Area

- **Function Key Display Area:** Different function text appears in different menu. The mapping function keys (F1-F4) are located at right. The function key is invalid if the text is blank.
- **Status Line:** This line shows the setting mode, value range, and test results.
- **RMT:** When the text is highlighted, it means the system is under on-line status.
- **LOCK:** When the text is highlighted, it means the system is under protection via parameter.
- **OFST:** When the text is highlighted, it means the leakage current has been offset by the system.

- **ERR**: When the text is highlighted, it means the system transmission is error.
- **Test State Indicator**: The DANGER indicator, when it lights up it indicates the instrument is under test condition and there is high voltage or mass current output on the test terminal. Do not touch the test terminal at this time.
- **Pass Indicator**: When it lights up it indicates the DUT passes the test. This indicator remains lit up until [STOP] is pressed.
- **Fail Indicator**: When it lights up it indicates the DUT fails the test. This indicator remains lit up until [STOP] is pressed.

2.1.2 Button Area

- **Power Switch**: The switch to supply the AC power source for this instrument.
- **Stop Button [STOP]**: Press this button the instrument will return to the ready state for testing and cut out output as well as clear all judgments.
- **Start Button [START]**: Press this button the instrument will be in test state, which means there are outputs at the test terminal and all judgment functions are activated.
- **Calibration Switch**: It is used by Chroma for calibration before shipping the product. Nonprofessional is prohibited to use this function to avoid causing any damage.
- **Function Keys**: There are different functions in different display menus. The mapping function description text is at right of the menu. The function key is invalid if the description text is blank.


2.1.3 Terminal Area

- **High Voltage Output Terminal**: The terminal of high voltage with high potential is located at high potential terminal for high voltage output. This test terminal is very dangerous especially when the DANGER indicator is lit up. Do not touch it when there is high voltage output.
- **Common Test Terminal (RET/LOW)**: It is the reference terminal at high voltage test, i.e. the low potential terminal almost equals to the chassis grounding.


2.2 Rear Panel

The rear panel is divided into several areas. This section describes the function of each area.

The standard rear panel of 19071/19072/19073:

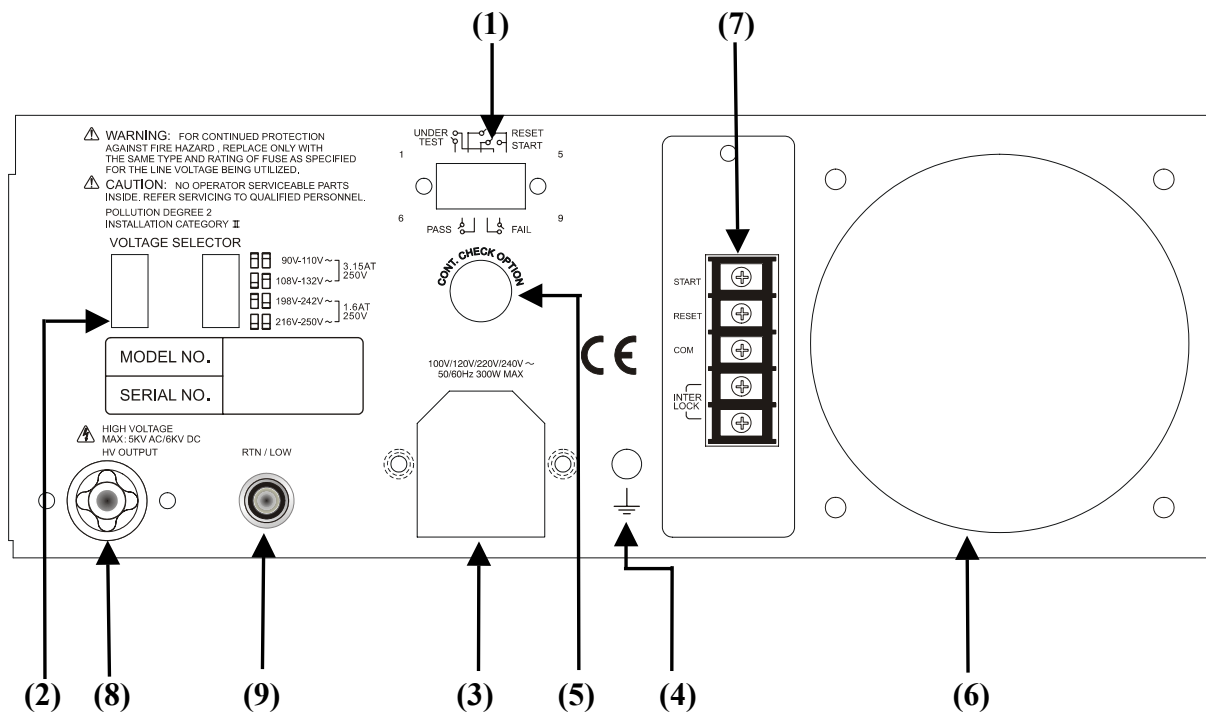


The rear panel of link test model of 19073 + RS485 is shown as below:

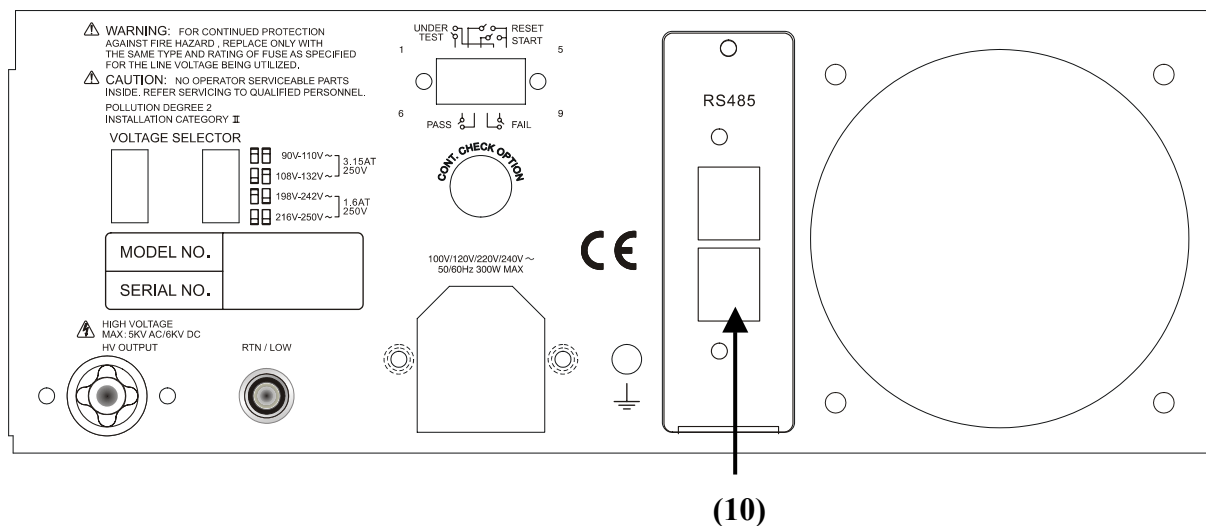

(1) REMOTE CONTROL

- The connection diagram of remote control signals is as the following.

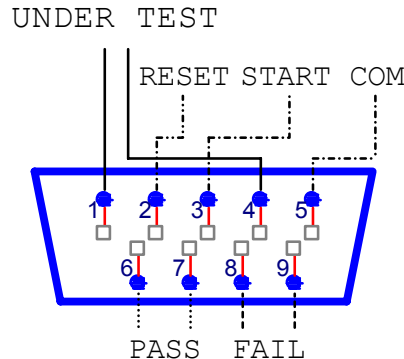

- **START:** The input terminal for start test signal.
- **RESET:** The input terminal for stop test signal.
- **COM:** The common input terminal for START and RESET signal.
- **UNDER TEST:** This terminal will short-circuit when in test mode, thus it can be used to control the external signal. The connecting point specification is 115V AC, current less than 0.3A. The action time is from the instrument enters the test mode until it is reset or completes the test.
- **PASS:** This terminal will short-circuit when the DUT passes the tests, thus it can be used to control the external signal. The connecting point specification is 115V AC, current less than 0.3A. The action time is from the DUT is passed until it is reset.
- **FAIL:** This terminal will short-circuit when the DUT fails the tests, thus it can be used to control the external signal. The connecting point specification is 115V AC, current less than 0.3A. The action time is from the DUT is failed until it is reset.

(2) VOLTAGE SELECTOR: Input Power Range Switch

- To change the input AC power source for the following 4 types:
 - Voltage range 90V ~ 110V AC (3.15AT, 250V)
 - Voltage range 108V ~ 132V AC (3.15AT, 250V)
 - Voltage range 198V ~ 242V AC (1.6AT, 250V)
 - Voltage range 216V ~ 250V AC (1.6AT, 250V)
- Be sure to use correct fuse when switch the power source.

(3) AC LINE: AC Power Socket and Fuse Holder

It is a three-pin power socket and a fuse holder. AC power is inputted from this socket to supply the AC source needed by this instrument. For detailed usage and specification of fuse, see *Chapter 3 Installation and Maintenance*.

(4) EARTH GROUND TERMINAL: Terminal Grounding for Safety

Use appropriate tools to ground this terminal surely. If it is not grounded surely, when the power circuit or any other devices connection short-circuited with the ground terminal, the instrument chassis may contain high voltage. This is very dangerous as it may cause electric shock if anyone touches it under the situation; therefore, it is necessary to connect the ground terminal to earth assuredly.

(5) CONTINUITY CHECK: Ground continue measuring and current output terminal

This function is for detecting ground continues of DUT grounding terminal.


(6) FAN

The fan is activated simultaneously when the tester is powered on.

(7) Expanded Slot

The standard is 5PIN terminal slot, this slot provides the following functions:

- The connection diagram of expanded slot signals is as the following.

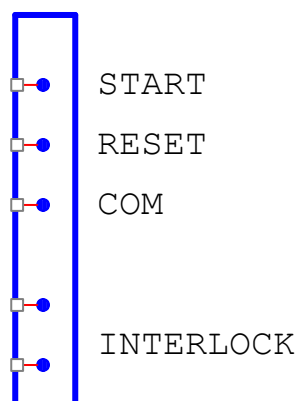

- START: Input terminal of starting test signal.
- RESET: Input terminal of stopping test signal.
- COM : Input common terminal of START and RESET signals.
- INTER LOCK: Short-circuited these two terminals, then can output high voltage.
(This function is only for installing 5PIN on expanded slot. If this unit is link test model of 19073 + RS485, these two terminals are short-circuited fixedly.)

(8) HV OUTPUT Terminal

This terminal is the same as HV output terminal of front panel.

(9) Common Test Terminal: RET/LOW

This terminal is the same as common test terminal of front panel.

(10) Expanded Slot

This slot supports two sockets of RJ-45, which provides multi-link function for the link test model of 19073 + RS485.

2.3 Operation

[Standby Menu]: The screen appears as below after powered on.

STEP 1/ 1 AC	LOW :OFF	PROGRAM
0.000KV	ARC :OFF	PRESET
0.500mA	RAMP:OFF	MENU
3.0s	FALL:OFF	MORE..
STANDBY	RMT	LOCK
	OFST	ERR

2.3.1 Memory Process

■ How to enter the Memory Process menu

(1) In **[Standby Menu]**, press the Function Key **[MENU]**, it appears:

1. MEMORY	LAST
2. SYSTEM	DOWN
3. OPTION	SELECT
4. CALIBRATION	EXIT
5. KEY LOCK	
SELECT FUNC.	RMT
	LOCK
	OFST
	ERR

(2) Use Function Key **[F1]** and **[F2]** to move the highlight to “MEMORY”, and press Function Key **[F3]** to enter memory process menu as below:

1. (0 STEPS)	STORE
2. (0 STEPS)	RECALL
3. (0 STEPS)	DELETE
4. (0 STEPS)	RETURN
5. (0 STEPS)	
SELECT FUNC.	RMT
	LOCK
	OFST
	ERR

(3) At this time select execution action by pressed Function Key **[F1]**, **[F2]** or **[F3]**, it appears:

1. (0 STEPS)	LAST
2. (0 STEPS)	DOWN
3. (0 STEPS)	SELECT
4. (0 STEPS)	RETURN
5. (0 STEPS)	
SEL. MEMORY	RMT
	LOCK
	OFST
	ERR

- (4) At this time use Function Key [F1] and [F2] to move the highlight to the memory for processing, then press Function Key [F3] will prompt a confirmation window. Press Function Key [ENTER] to confirm and Function Key [UP] or [DOWN] to select stored character of file name. Press [NEXT.C] to select next character and [ENTER] to confirm the file name, the maximum file name is 10 characters.

1. (2 STEPS) HIPOT	UP
2. (0 STEPS)	DOWN
3. (0 STEPS)	ENTER
4. (0 STEPS)	CANCEL
5. (0 STEPS)	
SEL. MEMORY	RMT LOCK OFST ERR

- (5) When executing [RECALL] or [DELETE] function, use Function Key [F1] and [F2] to move the highlight to the memory for processing, then press Function Key [F3] will prompt a confirmation window. Press Function Key [YES] to confirm or Function Key [NO] to cancel, then can recall or delete the memory set. Each memory contains test parameters, preset parameters and number of test steps.

1. (2 STEPS) HIPOT	LAST
2. (0 STEPS)	DOWN
3. (0 STEPS)	SELECT
4. (0 STEPS)	RETURN
5. (0 STEPS)	
SEL. MEMORY	RMT LOCK OFST ERR

2.3.2 System Setup

■ How to enter the SYSTEM SETUP menu

- (1) In [Standby Menu], press the Function Key [MENU] and by using Function Key [F1], [F2] to move the highlight to "SYSTEM" and then press Function Key [F3] to enter into the parameter setting menu as below:

1. CONTRAST	:	7	INC.
2. BUZZER VOLUME	:	HIGH	DEC.
3. EN50191	:	OFF	NEXT
4. DC 50V AGC	:	ON	RETURN
5. PASS ON	:	OFF	
1-15	RMT	LOCK	OFST ERR

- (2) Use Function Key [F3] to move the highlight to the parameter item you want to set, then use Function Key [F1] and [F2] to set the parameter data.

(3) System Parameter Setting Table

Item	Range	Default	Description
CONTRAST	1~15	7	Adjust the LCD brightness
BUZZER VOLUME	HIGH/MEDIUM/ LOW/OFF	HIGH	Adjust the buzzer volume
EN50191	ON/OFF	OFF	The output is meet to EN50191 requirement (AC Max 3mA,DC Max 5mA)
DC 50V AGC	ON/OFF	ON	Select if open hardware AGC as DC voltage setting is 50V~499V. (When this item is OFF, hardware AGC is opened only DC voltage set to above 500V automatically.)
PASS ON	OFF, 0.1sec-10sec	OFF	When set time to PASS ON, after the setting time for PASS ON is end then PASS signal will be deleted automatically. When set time to OFF, then PASS signal continue until press any key to delete.
END OF STEP	ON/OFF	OFF	When the setting is ON, as all STEPs are end the signal for Under Test will auto exit from 10mS. When the setting is OFF, only all STEPs are end the signal for Under Test will exit from 10mS.

2.3.3 PRESET Parameter Setting

■ How to enter the PRESET menu

In [Standby Menu], press Function Key [PRESET] to enter the PRESET menu as shown below:

1.AC V FREQUENCY:	60Hz	UP
2.SOFTWARE AGC :	ON	DOWN
3.WV AUTO-RANGE:	OFF	NEXT
4.IR AUTO-RANGE:	ON	EXIT
5.GFI :	ON	
50Hz/60Hz	RMT	LOCK
OFST	ERR	

- (1) After entering the PRESET parameter setting menu, press Function Key [F3] to move the highlight to the parameter item you desired to set.
- (2) Press Function Key [F1] and [F2] to set the parameter data.
- (3) PRESET parameter function table as shown below:

Item	Range	Default	Description
ACV FREQUENCY	50 / 60 Hz	60Hz	Set the output voltage frequency at AC HiPot test.
SOFTWARE AGC	OFF / ON	ON	Set if open the software AGC function.
WV AUTO-RANGE	OFF / ON	OFF	Set if open the HiPot auto range function.
IR AUTO-RANGE	OFF / ON	ON	Set if open the insulation auto range function.
GFI	OFF / ON	ON	Set if open the GFI function.
FAIL RESTART	OFF / ON	OFF	Set if restart directly when fails the test.

2.3.4 PROGRAM Parameter Setting

■ Test parameter setting

- (1) In [Standby Menu], press Function Key [PROGRAM] to enter the PROGRAM setting menu as the following:

STEP 1/1	AC	LOW : OFF	NEW
		ARC : OFF	
VOLT : 0.050kV		RAMP : OFF	MORE..
HIGH : 0.500mA		FALL : OFF	
TIME : 3.0s			NEXT
1-10	RMT	LOCK	OFST
		ERR	EXIT

■ Test steps setting

- (1) Press [F3] to move the highlight and stay in the test item. When Function Key [F1] shows “UP”, it means press this key can switch to the next test step. When Function Key [F1] shows “NEW”, it means press this key can add a test step. When Function Key [F1] shows “FIRST”, it means press this key can switch the first test step.

- (2) Use Function Key [F2] can switch the functions as shown below:

STEP 2/2	AC	LOW : OFF	DELETE
		ARC : OFF	
VOLT : 0.500kV		RAMP : OFF	INSERT
HIGH : 0.500mA		FALL : OFF	
TIME : 3.0s			DOWN
VOLTAGE IS 0	RMT	LOCK	OFST
		ERROR	RETURN

- (3) Function Key [DELETE] to delete a selected test step.

- (4) Function Key [INSERT] to insert a new test step set.

(5) Function Key [DOWN] to select to previous test step set.

■ Selecting Test Mode

Press Function Key [F3] to move the highlight and stay in the test item. Use Function Key [F1] and [F2] to select the test mode. There are AC/GC/PA/OS, AC/DC/GC/PA/OS and AC/DC/IR/GC/PA/OS test modes for selection by different model. Different test mode has different test parameters for setting.

- **Description of each test parameter setting:** The following explain the parameter setting of each test mode.

(1) AC HiPot Test Mode

STEP 1/1	AC	LOW : OFF	UP
		ARC : OFF	
VOLT:0.000kV		RAMP: OFF	DOWN
HIGH:0.500mA		FALL: OFF	
TIME: 3.0s			NEXT
			EXIT
[SELECT MODE] [RMT] [LOCK] [OFST] [ERR]			

VOLT : Set the required voltage for HiPot test.

HIGH : Set the upper limit for leakage current.

TIME : Set the required time for testing, 0 means continuous test. (Judge the high and low limit for leakage current during the time.) The voltage value is shown which within specification, the minimum test time should be equal to 0.3 second. When the displayed voltage is not reach to 9/10(Software AGC ON) or 2/3(Software AGC OFF) of setting voltage value, the judgment function will show FAIL.

LOW : Set the low limit for leakage current, 0 means OFF.

ARC : Set the high limit for ARC, 0 means OFF.

RAMP : Set the required time for rising to selected voltage, 0 means OFF.

FALL : Set the required time for falling from selected voltage to zero, 0 means OFF.

(2) DC HiPot Test Mode

STEP 1/1	DC	LOW : OFF	UP
		ARC : OFF	
VOLT :0.000kV		RAMP : OFF	DOWN
HIGH :0.500mA		DWELL: OFF	
TIME : 3.0s		FALL : OFF	NEXT
		I-RUS: OFF	
			EXIT
[SELECT MODE] [RMT] [LOCK] [OFST] [ERR]			

VOLT : Set the required voltage for HiPot test.

HIGH : Set the high limit for leakage current.

TIME : Set the required time for testing, 0 means continuous test. (Judge the high and low limit for leakage current during the time.) The voltage value is shown which within specification, the minimum test time should be equal to 0.2 second. When the displayed voltage is not reach to 9/10(Software AGC ON) or 2/3(Software AGC OFF) of setting voltage

- value, the judgment function will show FAIL.
- LOW : Set the low limit for leakage current with the value less than the high limit for leakage current or OFF.
- ARC : Set the high limit for ARC, 0 means OFF.
- RAMP : Set the required time for rising to selected voltage, 0 means OFF.
- DWELL : Set DWELL time, 0 means OFF. (Do not judge the high and low limit for leakage current during DWELL TIME operation, but do not over the high limit of setting range.)
- FALL : Set the required time for falling from selected voltage to zero, 0 means OFF.
- I-RUS : Set the low limit for inrush current, 0 means OFF.

(3) Insulation Resistance Test Mode

STEP 1/1	IR	HIGH : OFF	UP
		RAMP : OFF	
VOLT : 0.000kV	DWELL: OFF	DOWN	
LOW : 1.0MΩ	FALL : OFF		
TIME : 3.0s		NEXT	
SELECT MODE	RMT	LOCK	OFST
ERR	EXIT		

- VOLT : Set the required voltage for insulation resistance test.
- LOW : Set the low limit for insulation resistance.
- TIME : Set the time required for test, 0 means continuous test. (Judge the high and low limit for insulation resistance during the time.)
- HIGH : Set the high limit for insulation resistance with the value larger than the low limit of insulation resistance or OFF.
- DWELL: Set the required time for test, 0 means OFF. (Do not judge the high and low limit for insulation resistance during this period.)
- FALL : Set the required time for falling from selected voltage to zero, 0 means OFF.

(4) Ground Continue Mode

STEP 1/1	GC	LOW : OFF	UP
CURR : 0.0A		DOWN	
HIGH : 1.0Ω			
DWELL: 0.3s		NEXT	
SELECT MODE	RMT	LOCK	OFST
ERR	EXIT		

- CURR : Set the output current (0.1A maximum).
- HIGH : Set the high limit of ground continue (0.1Ω ~ 5Ω).
- DWELL : Set the time required for test (0.1 sec ~ 1 sec). (Do not judge the high and low limit for ground continue during the time.)
- LOW : Set the low limit for ground continue with the value lower than the high limit of ground continue or OFF.

(5) Pause Mode

STEP 1/1	PA					UP
PAUSE: PAUSE MODE						DOWN
UNDER TEST SIGNAL: OFF						NEXT
SELECT MODE	RMT	LOCK	OFST	ERR		EXIT

- PAUSE : Set the signal shown on menu when pause, the maximum length is 15 characters.
- UNDER TEST SIGNAL : Set UNDER TEST signal on the rear panel and DANGER indicator on the front panel when pause.

(6) Open/Short Detection Mode (OS)

STEP 1/1	OS	OPEN : 50%				UP
		SHORT: 300%				DOWN
						NEXT
SELECT MODE	RMT	LOCK	OFST	ERR		EXIT

- OPEN : Set the judgment test result is the condition for open(compare the test reading with the standard capacitance value[Cs] be read).
- SHORT : Set the judgment test result is the condition for short(compare the test reading with the standard capacitance value[Cs] be read).

2.4 How to Perform Tests

■ Test Cable Offset Calibration

- (1) In [Standby Menu], press Function Key [MORE..] to enter the test menu of multiple STEPS.
- (2) Press Function Key [OFFSET], the monitor will show a menu to indicate you to open the output terminal.
- (3) Press [START], the DANGER indicator on the front panel will light up. The test time is 5 seconds. The system starts to measure the test cable offset and shows the reading on monitor, then saves it to memory.


■ Connection the DUT

First, ensure there is no voltage output and the DANGER indicator is off. Then connect the low potential test cable (black) to the common test terminal on system, and secure it with fixed plate. Short-circuit the test cable and high voltage output terminal. After confirming no high voltage is output, connect the DUT with low potential test cable first and high potential test cable later, and then plug in the high voltage test cable (red or white) to "High Voltage Output Terminal".

■ Test Steps(AC/DC/IR/GC)

(1) Connection the DUT with correct procedures.

(2) In **[Standby Menu]** (as shown below):

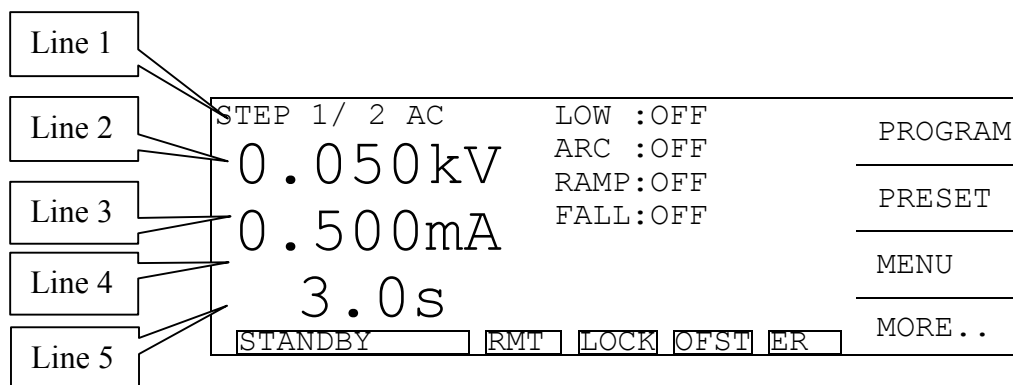

1. STEP 1/2 in "Line 1" indicates there are 2 test steps, and currently it is executing step 1. M02 1/2 in "Line 1" indicates this test parameter set have saved into the index 2 memory. There are 2 test steps in the memory, and currently it is executing step 1.
2. AC in "Line 1" indicates this step is AC HiPot test mode.
3. "Line 2" indicates the output voltage set for test.
4. "Line 3" indicates the high limit for leakage current under STANDBY state in AC or DC HiPot test mode; or the low limit for insulation resistance under STANDBY state in IR test mode. When in TEST mode, it is the value of real leakage current or insulation resistance.
5. "Line 4" indicates the testing time set under STANDBY state; or the remaining testing time under TEST state.
6. "Line 5" is the "Status Line" that shows the current state or test results.

(3) Press [STOP] to enable it standby for test and the "Status Line" shows "STANDBY".

(4) Press [START] to begin the test. It will begin to output the test voltage. The DANGER indicator lights up and the "Status Line" shows "UNDER TEST" to warn you that it is in test state and there is mass voltage output. "Line 2" will show the output voltage reading, "Line 3" will show the reading of leakage current or insulation resistance, and "Line 4" performs timing and countdown work.

(5) PASS Judgment

When all test steps are done and "Status Line" shows PASS, it indicates the DUT is a quality product. Then the output is cut out, rear panel outputs the PASS signal and buzzer (short beep) in the meantime.

(6) FAIL Judgment

If the measurement is abnormal, the system will judge the DUT as a failed product and cut out the output. The rear panel outputs FAIL signal and buzzer (long beep) in the meantime. The action continues until [STOP] key is pressed. "Status Line" will show fail state as below.

Test Result	Meaning
PASS	Passed the tests judge as PASS product
HIGH FAIL	Measurement is over the high limit
LOW FAIL	Measurement is under the low limit
ARC FAIL	Current ARC is over the high limit
I/O FAIL	Hardware detects bad signal
NO OUTPUT	Output is not enough (Maybe the test time is not enough)
VOLT OVER	Voltage reading is over the hardware valid digits
CURR OVER	Current reading is over the hardware valid digits
INRUSH FAIL	Charging current is over low (Test fixture bad contact)
GFI TRIPPED	Grounding failed interrupted


(7) If any errors happen and cause the [START] key to be locked, you can press [STOP] to release it.

(8) You can press [STOP] key anytime to stop the test output in any case.

■ Test Steps(OS)

(1) Connection the DUT with correct procedures.

(2) In [Standby Menu] (as shown below):

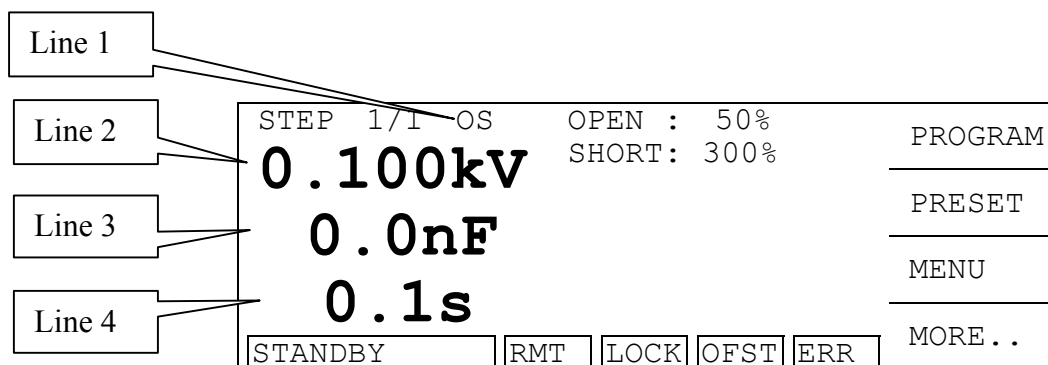

1. OS in “Line 1” indicates this step is **open/short detection mode**.
2. “Line 2” indicates the output voltage set for test.
3. “Line 3” indicates the capacitance value for reading.
4. “Line 4” indicates the test time.

(3) Press [STOP] to enable it standby for test and the “Status Line” shows “STANDBY”.

- (4) Please press [MORE..] to enter the test menu of multiple STEPS, the menu as shown below:

1	OS	OUTPUT	MEASURE	RESULT	OFFSET
		0.100kV	0.0nF	-----	
					GET Cs
STANDBY		RMT	LOCK	OFST	ERR
		MORE..			

1. Please press [OFFSET] to perform OFFSET elimination at first. It is need to perform OFFSET elimination again when change the wire or fixture every time. This is for ensure the accuracy for the test.
2. It is need that the capacitance standard sample for the test as the DUT when test or change new DUT of capacitance. Press [GET Cs] to read the standard capacitance value for the value when test.
3. Please press [MORE..] again to back to standby menu.
4. Press [START] to begin the test. It will begin to output the voltage. The DANGER indicator lights up and the “Status Line” shows “UNDER TEST” to warn you that it is in test state and there is voltage output. “Line 2” will show the voltage output reading, “Line 3” will show the reading of capacitance, and “Line 4” performs timing and countdown work.

Note: When test OSC Mode, Get Cs current range at this time decides the display of capacity effective digit.

Example: Get Cs voltage 0.018kV, Get Cs capacitance value 17.4nF, current= 1.18mA -- at the mass current range.

Get Cs voltage 0.016kV, Get Cs capacitance value 17.42nF, current= 0.97mA -- at the medium current range.

(5) PASS Judgment

When all test steps are done and “Status Line” shows PASS, it indicates the DUT is a good product. Then the output is cut off, rear panel outputs the PASS signal and buzzer (short beep) in the meantime.

(6) FAIL Judgment

If the measurement is abnormal, the system will judge the DUT as a failed product and cut off the output. The rear panel outputs FAIL signal and buzzer (long beep) in the meantime. The action continues until [STOP] key is pressed. “Status Line” will show fail state as below.

Test Result	Meaning
OPEN FAIL	Capacitance open/capacitance reading is lower than the setting of OPEN CHK.
SHOP FAIL	Capacitance short/capacitance reading is higher than the setting of SHORT CHK.

- (7) If any errors happen and cause the [START] key to be locked, you can press [STOP] to release it.
- (8) You can press [STOP] key anytime to stop the test output in any case.

2.5 Other User Setting Function

2.5.1 KEY LOCK Function

■ Setting KEY LOCK

In [Standby Menu], you can enable KEY LOCK function if **LOCK** is not highlighted.

- (1) Press Function Key [MENU], use Function Key [F1] and [F2] to move the highlight to “KEY LOCK”, and press Function Key [SELECT] to enter into the KEY LOCK setting menu.

KEY LOCK					A
USER PASSWORD:****					B
					ENTER
					RETURN
1-10 CHAR.	RMT	LOCK	OFST	ERR	

- (2) Use Function Key [A] and [B] to input the PASSWORD (default is AAAA.)
- (3) Press Function Key [ENTER] will prompt a selection window is highlighted.

KEY LOCK ON !					YES
RECALL LOCK ?					NO
					CANCEL
YES/NO	RMT	LOCK	OFST	ERR	

- (4) You can press Function Key [YES] or [NO] to select if lock the MEMORY RECALL function as well. Exit the menu after completing KEY LOCK function and **LOCK** is highlighted in the meantime.
- (5) Press Function Key [CANCEL] to cancel the action and exit the set menu.

■ Canceling KEY LOCK

In [Standby Menu], you can release KEY LOCK if **LOCK** is highlighted. Follow the steps above to cancel KEY LOCK, and **LOCK** will not be highlighted.

2.5.2 Auto Range

- (1) Set WV-AUTO RANGE as ON under PRESET function list.
- (2) The current set to high range as below shown.

STEP 1/1 AC	LOW : OFF	PROGRAM
0.050kV	ARC : OFF	
20.00mA	RAMP : OFF	PRESET
3.0s	FALL : OFF	MENU
STANDBY	RMT	LOCK OFST ERR MORE..

- (3) The test is ended before 0.6 sec, if the current is shown as low range then the current auto range to low range as the following figure.

STEP 1/1 AC	LOW : OFF	PROGRAM
0.050kV	ARC : OFF	
0.100mA	PASS	PRESET
0.0s		MENU
PASS	RMT	LOCK OFST ERR MORE..

2.5.3 Change User Password

- (1) In [Standby Menu], press Function Key [MENU], and use Function Key [F1] and [F2] to move the highlight to “CHANGE PASSWORD” and press Function Key [SELECT] to enter into the password menu.

CHANGE PASSWORD	A
USER PASSWORD:****	B
	ENTER
1-10 CHAR.	RETURN
RMT	LOCK OFST ERR

- (2) Use Function Key [A] and [B] to input the original PASSWORD (default is AAAA), and press Function Key [ENTER] will show the following “NEW PASSWORD” window.

CHANGE PASSWORD					A
NEW PASSWORD: ****					B
					ENTER
1-10 CHAR.	RMT	LOCK	OFST	ERR	RETURN

- (3) Use Function Key [A] and [B] to input the NEW PASSWORD (maximum 10 characters), and press Function Key [ENTER] will display the “CONFIRM” window.

CHANGE USER PASSWORD					A
CONFIRM:					B
					ENTER
Input CODE		LOCK	OFST		EXIT

- (4) Use Function Key [A] and [B] to input the NEW PASSWORD, and press Function Key [ENTER]. Press [RETURN] after completing the setting.

2.5.4 Remote Control

- **Be aware** when using remote control by external signal and do not touch the high voltage terminal to avoid causing any danger.
- The REMOTE outlet for remote control switch is located at the rear panel. You can plug in the control line to use external signal for controlling the device output externally.
- Remote control is usually done by high voltage testing bar; however, you can also use other control circuit to do it. Be careful that it is the switch to control high voltage output, so you must connect the control line with caution and do not get near the high voltage terminal and test cable to avoid causing any danger.
- For single control of START and RESET signals follow Figure 1 listed below to connect them to the REMOTE position on the system back panel.
- If it is connected as Figure 2 shows, the system routine is in RESET state as the NC is connected to RESET and NO is connected to START.

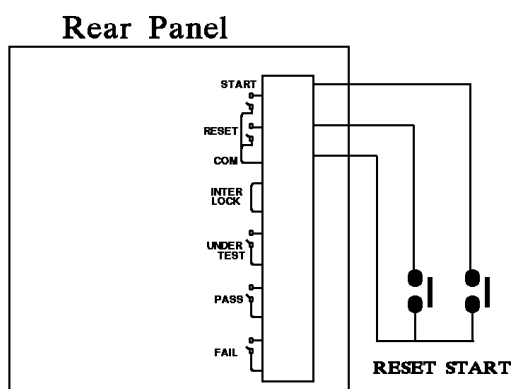


Figure 1

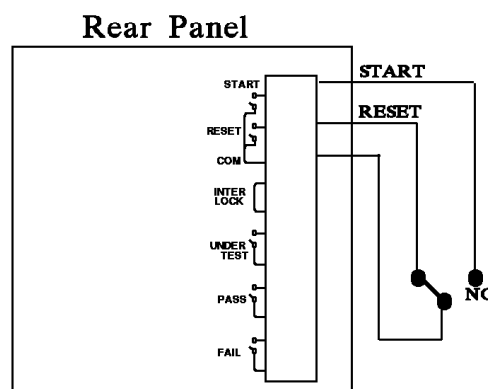


Figure 2

- The logic components of transistor, FET and couplers can be connected and used as control circuit. The connected signals and circuit are shown as below. To use this circuit to control the system, it must contain the following:
 - (1) The current of LOW signal is 2mA or less.
 - (2) The active time for input signal is more than 20mS.

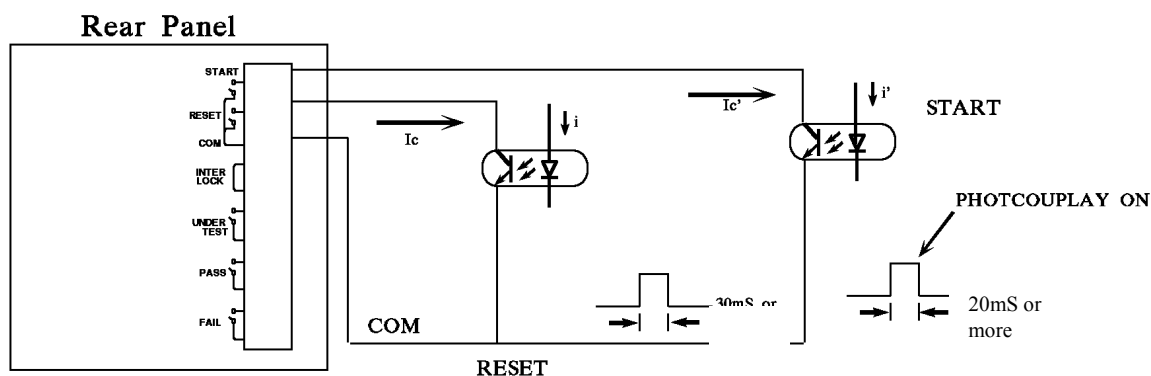


Figure 3

- Either the relay switch control in Figure 1 or the coupler control in Figure 3 uses the contact of components for control action. It can prevent the error operation from interference effectively. Though the system has a lot of precautions, you would still need to watch out the interference caused by the measurement system settings.

2.5.5 Output Signal

This instrument has indicator and beeper for indication signals. The output signals in the system rear panel are:

- UNDER TEST: This terminal will short-circuit when in test mode, thus it can be used to control the external signal. The connecting point specification is 115V AC, current less than 0.3A.
- PASS: This terminal will short-circuit when the DUT passes the tests, thus it can be used

to control the external signal. The connecting point specification is 115V AC, current less than 0.3A. The action time is from the DUT is passed until it is stopped.

- FAIL: This terminal will short-circuit when the DUT fails the tests, thus it can be used to control the external signal. The connecting point specification is 115V AC, current less than 0.3A. The action time is from the DUT is failed until it is stopped.

3. Installation and Maintenance

3.1 Notices for Installation

This instrument generates high voltage output up to 6KV for external test. Any incorrect or mistaken procedures in using this instrument may cause injury or death. Thus for your safety, be sure to read through the notices described in this chapter and memorize them to prevent any accidents from happening.

- **Induction and electric shock**

To avoid electric shock, we suggest you to put on the insulation rubber gloves before performing any electricity related work.

- **Grounding**

There is a safety grounding terminal at the instrument rear panel. Ensure to use appropriate tools to connect the grounding terminal surely. If it is not grounding correctly, the chassis of test machine may contain high voltage when the power circuit or the connecting line of any devices short-circuited with the grounding terminal. This is very dangerous as it may cause electric shock if anyone touches the instrument under the circumstances. Therefore, it is necessary to connect the safety grounding terminal to earth correctly. See *2.2 Rear Panel Description* for detail information.

- **Connecting test cable to the “Common Test Terminal”**

Please connect the test cable to “Common Test Terminal” actually. Always check if the test cable is connected properly during test. When you need to connect the test cable to the unit for test, use the one on Common Test Terminal first to connect the DUT. It is very dangerous if the test cable on Common Test Terminal is not connected completely or loose as the entire DUT may contain high voltage. Refer to *2.1 Front Panel Description*.

- **Connecting test cable to the “High Voltage Output Terminal”**

Follow the procedures below to connect the high voltage output line after the “Common Test Terminal” is connected.

- Press [STOP] button first.
- Ensure the DANGER indicator is off.
- Short circuit the “Common Test Terminal” test cable and “High Voltage Output Terminal”, and ensure there is no voltage output.
- Last, connect the “Common Test Terminal” test line to the DUT and then the high voltage test cable to the DUT.
- Plug in the high voltage test cable to the “High Voltage Output Terminal”.

- **End test**

When tests are done and the test instrument is not in use or need to leave for a while during usage, make sure to turn off the power switch (to O). See *2-1 Front Panel Description* for detail information.


- **Dangerous places when the instrument is in test mode**

It is very dangerous to touch the area with high voltage such as the DUT, test cable,

probe, and output terminal when the instrument is in test mode.

※ **DO NOT touch the alligator clip as shown below on the test cable when the system is in test mode as the rubber insulation is not good enough and may cause danger if touched.**

Do not touch it when in high voltage output

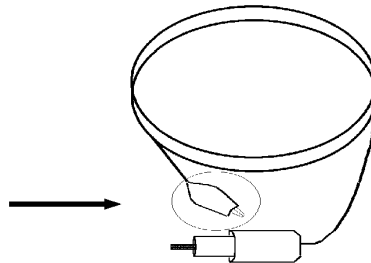

■ End test confirmation

You may touch the DUT, high voltage test cable or high voltage output area like output terminal in order to alter the layout or perform particular test request, thus be sure to turn off the power before doing it. For testing the DC HiPot/insulation resistance, the DUT may contain high voltage after completing the test, so you need to carefully follow the instructions described in this chapter to perform the work.


3.1.1 Charging During DC HiPot/Insulation Resistance Test

■ Charge

When doing DC HiPot/insulation resistance test, the DUT, capacitor, test cable, probe and output terminal, even the test instrument may charge with high voltage. The charged voltage may need a period of to discharge after the power switch is turned off. Do not touch any places that may cause electric shock as mentioned above especially at the moment of turning off the power.

■ Confirming the charged voltage is discharged totally

the test voltage applied as well as the DUT characteristics determines the total discharge time for the charged voltage. Assuming the high voltage on the DUT is the voltage plus a 0.01uF capacitor paralleling a 100MΩ resistance circuit, then after turning off the power the voltage on test instrument and DUT takes about 3.5 seconds to decrease to 30V. Thus when the test voltage is 500V, it needs about 2.8 seconds. Suppose we already know the time constant of a DUT, you can follow the description above to calculate the time required for voltage decreasing to beneath 30V after turning off the power. The method is using the time decreased to under 30V multiplies the time constant ratio as the figure shown below.

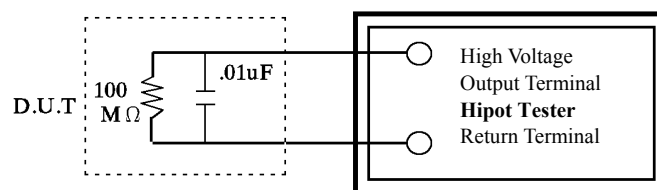

<Formula>

Test Voltage * $e^{-t/RC}$ = Residual Voltage

Ex.: $1000V * e^{-t/RC} = 30V$

$\ln^{-t/RC} = \ln 0.03$

$-t / RC = -3.5$

$t = 3.5 \text{ sec}$

■ **Remote control system**

This system is capable of remote control. Usually it uses external control signal to do the high voltage output control. For your safety and to prevent accidents, the following principles of control must be performed accurately. Do not allow any unexpected high voltage output to cause any hazards. When the system has high voltage output, operators and other personnel are not allowed to touch the DUT, test cable and probe and output terminal, etc.

■ **Turn the power switch on or off ※Attention※**

Once the power switch is cut off, wait a few seconds to turn it on again. Do not turn on/off the power switch repeatedly to avoid causing any errors. It is very dangerous to do repeating power on/of in high voltage output state.

The high voltage output terminal cannot connect to any objects during power on or off to avoid hazards caused by abnormal high voltage output.

■ **Miscellaneous notices**

Do not short circuit the instrument output line, grounding line, transmission line, or other connector grounding line, and AC source to avoid the entire test device being charged to a very dangerous voltage. To short circuit the High Voltage Output Terminal and Common Test Terminal, the instrument chassis must be grounded to earth first.

3.1.2 Emergency Events

■ **Emergency management**

In the emergency situations of electric shock, DUT on fire or system on fire, follow the steps below to avoid causing bigger hazards.

- First, cut off the power switch.
- Then, unplug the power cord.

3.1.3 Solving Problems

■ **When problem happens**

The problems in the following conditions are very dangerous. The output terminal may still have high voltage output even the [STOP] button is pressed, so you need to be very careful.

- The DANGER indicator still lights up after the [STOP] button is pressed.
- There is no reading on voltage meter, however the DANGER indicator is lit.

When any of the above conditions happens, turn off the power and unplug the AC

power cord. Do not use it again as the failure is very dangerous. Send it back Chroma or dealer for repair and services.

- **DANGER indicator failure**

If you press the [START] button and the voltage meter shows readings but the DANGER indicator is still off, it means the indicator may be failure. Turn the instrument off and replace it immediately, then return the malfunction device to Chroma or dealer for repair and services.

- **Notices when operating the instrument of long duration under normal condition**

If the setting high limit closes to the rated value, pay attention to the temperature changes. Stop using it if the ambient temperature is over 40°C. Wait until the temperature is down to normal to resume the operation, and the instrument must be inspected first.

- **There are four types of AC INPUT power source used in this instrument**

Switch the voltage selector on the rear panel to the correct position according to the voltage used locally. Ensure the AC power source is same as marked on the power switch that located on the rear panel, and the fuse is changed to the appropriate one when plug in the power cord. Following table lists the fuses for the voltage used:

Center Voltage	Range	Fuse
100V	90V ~ 110V	3.15A Slow/250V
120V	108V ~ 132V	3.15A Slow/250V
220V	198V ~ 242V	1.6A Slow/250V
240V	216V ~ 250V	1.6A Slow/250V

The fuse should conform to the voltage used and replace it when the power cord is unplugged to avoid electric shock. When replacing the fuse, press the fuse holder inside the power socket then remove the existing fuse and insert the new one, then plug in the power cord.

⚡ **Caution**

Be sure to use correct fuse when changing it, or it may cause danger easily.

- **This instrument operates in AC power source.**

If the power source is unstable in the range selected, it may cause the instrument to act abnormally or inaccurately. Please use appropriate equipment such as power regulator to convert it to applicable power source.

- **This instrument uses the power transformer 200VA or above.**

If the tested device draws a great amount of current, it may flow in large current (about 10 Ampere) up to 10mS before the judgment of fail and output current cut off. The same situation may occur before performing the test. Thus it is necessary to pay attention to the capacity of power cord and the current line linked with other instruments and devices.

- **Storage**

The normal temperature range is 18°C~28°C, ≤ 70% RH. The operation may incorrect

if over the range. The storage temperature is $-10^{\circ}\text{C}\sim 60^{\circ}\text{C}$, $\leq 80\% \text{ RH}$. If you are not planning to use it for a long period of time, pack it with the original box for storage. For the sake of correct test and safety of this instrument, make sure not to store it in a place with direct sunlight or high temperature, also away from shaky, damp and dusty area.

- **Warming up**

This instrument activates at power on; however, in order to meet the accuracy specified in the specification, please warm it up for 15 minutes or above.

- **Safety Symbols**



: It indicates the output terminal may contain lethal voltage. Read all safety operation notices carefully.



: It indicates to read the detailed descriptions in the user's manual.



: It indicates the grounding protect terminal, which is used to prevent electric shock from the leakage on chassis. The ground terminal must connect to earth before using the product.

Warning: This is to warn user to avoid the product misuse due to procedures, applications or other reasons. It may cause hazard to human if the warning is neglected.

Caution: This indicates the caution to user to avoid the product misuse due to procedures, applications or other reasons. It may cause unexpected result to the product itself and the DUT if the caution is neglected.

Note: This indicates important information or tips for the procedures and applications, etc. The contents should be read carefully.

- **Warning Signal of Testing**

“DANGER – HIGH VOLTAGE TEST IN PROGRESS, UNAUTHORIZED PERSON
KEEP AWAY”

3.2 Notices for Maintenance

Except notified in the manual there is no items can be maintained by user in this device.

Please contact Chroma or sales agent when any abnormal condition occurs in this device. Do not perform maintenance by yourself to avoid causing any unnecessary hazards that may damage the device.

3.3 Troubleshooting

Besides replacing the fuse (see *3.1.3 Solving Problems*) or other notified in the manual, there is no troubleshooting to be performed by user.

Please contact Chroma or sales agent when any abnormal condition occurs in this device. Do not perform maintenance by yourself to avoid causing any unnecessary hazards that may damage the device.

3.4 Input/Output Pin Assignment

See the descriptions of front panel and rear panel in Chapter 2.

4. Calibration Procedure

Before performing this section the HiPot tester must warm up at least for 30 minutes. Take off the calibration label at the front panel and press the lock switch. After completed the calibration, please press the lock switch again for opening the hardware data backup protection circuit to avoid calibration data loss.

The following items are required for calibration.

■ Voltage Calibration (See 4.2)

ACV 5KV Offset (0.05kV)	; AC HiPot Voltage Offset calibration (AC Mode)
ACV 5KV Full (4KV)	; AC HiPot Voltage Full calibration (AC Mode)
DCV 6KV Offset (0.05kV)	; DC HiPot Voltage Offset calibration (DC/IR Mode)
DCV 6KV Full (4KV)	; DC HiPot Voltage Full calibration (DC/IR Mode)
IRV 1KV Offset (0.05kV)	; IR Impedance Voltage Offset calibration (DC/IR Mode)
IRV 1KV Full (1kV)	; IR Impedance Voltage Full calibration (DC/IR Mode)

■ Current Calibration (See 4.3)

ACA 3mA Offset (0.12mA)	; AC HiPot current 3mA range Offset calibration (AC Mode)
ACA 3mA Full (2.4mA)	; AC HiPot current 3mA range Full calibration (AC Mode)
ACA 20mA Offset (2.4mA)	; AC HiPot current 20mA range Offset calibration (AC Mode)
ACA 20mA Full (12mA)	; AC HiPot current 20mA range Full calibration (AC Mode)
DCA 3mA Offset (0.12mA)	; DC HiPot current 3mA range Offset calibration (DC/IR Mode)
DCA 3mA Full (2.4mA)	; DC HiPot current 3mA range Full calibration (DC/IR Mode)
DCA 5mA Offset (2.4mA)	; DC HiPot current 5mA range Offset calibration (DC/IR Mode)
DCA 5mA Full (4.8mA)	; DC HiPot current 5mA range Full calibration (DC/IR Mode)

■ ARcing Calibration (See 4.4)

AC ARC 20mA (7mA)	; AC Withstanding Voltage ARcing calibration (AC Mode)
DC ARC 5mA (5mA)	; DC Withstanding Voltage ARcing calibration (DC Mode)

■ Insulation Resistance Calibration (See 4.5)

IRR Range1 (1000M Ω)	; IR Resistor range 1 calibration (IR Mode)
IRR Range2 (100M Ω)	; IR Resistor range 2 calibration (IR Mode)
IRR Range3 (10M Ω)	; IR Resistor range 3 calibration (IR Mode)
IRR Range4 (10M Ω)	; IR Resistor range 4 calibration (IR Mode)

■ Ground Continue Calibration

GC 5 Ω Offset (1 Ω)	; GC 5 Ω offset calibration
GC 5 Ω Full (3 Ω)	; GC 5 Ω full calibration

■ LCD Contrast Calibration


CAL. CONTRAST (7) ; LCD contrast calibration

4.1 Calibration

- Press [MENU].
- Press [UP] or [DOWN] to select “CALIBRATION”.
- Press [SELECT].
- Press [A][A][A][B][ENTER].

4.2 Voltage Calibration

4.2.1 Connection Diagram

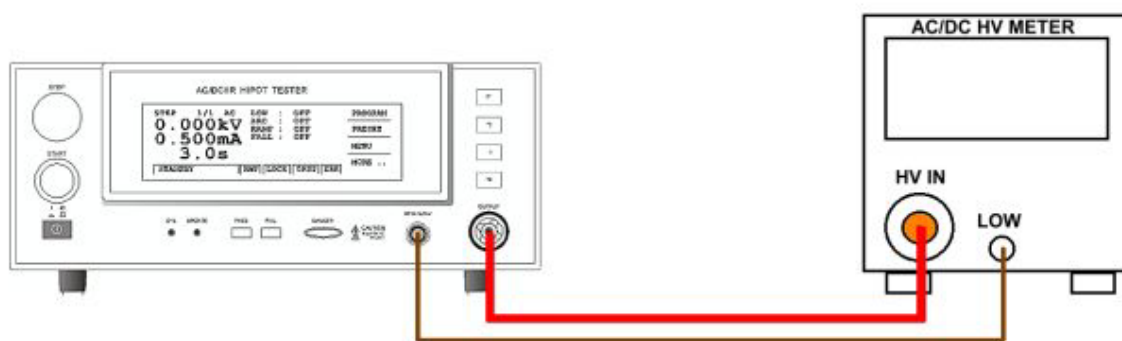

4.2.2 ACV Calibration (AC Mode)

- (1) Press [UP] or [DOWN] to select ACV offset calibration.
- (2) Connect an AC high voltage meter to HiPot tester.
- (3) Press [STOP][START]; reading the high voltage meter value, ex. 0.052kV.

ACV 5kV OFFSET (0.05kV)		60Hz	UP
OUTPUT	READING		DOWN
0.050kV	0.050kV		SETUP
STANDARD : 0.052kV			EXIT
<div style="border: 1px solid black; display: inline-block; width: 100px; height: 20px;"></div> <div style="border: 1px solid black; display: inline-block; width: 50px; height: 20px; text-align: center;">RMT</div> <div style="border: 1px solid black; display: inline-block; width: 50px; height: 20px; text-align: center;">LOCK</div> <div style="border: 1px solid black; display: inline-block; width: 50px; height: 20px; text-align: center;">OFST</div> <div style="border: 1px solid black; display: inline-block; width: 50px; height: 20px; text-align: center;">ERR</div>			

- (4) Press [INC.] or [DEC.] until the Standard Value display 0.052 kV and then press

- [ENTER] for saving.
- (5) Press [STOP] to stop ACV voltage offset calibration.
 - (6) Press [UP] to change to the next calibration item.
 - (7) Press [STOP][START] to read the high voltage meter value, ex. 4.052kV.

ACV 5kV FULL (4.0kV)		60Hz	UP
OUTPUT	READING		DOWN
4.000kV	4.000kV		SETUP
STANDARD : 4.052kV			EXIT
	RMT	LOCK	OFST ERR

- (8) Press [INC.] or [DEC.] until shows 4.052 kV and press [ENTER] for saving.
- (9) Press [STOP] to stop ACV voltage full scale calibration.

4.2.3 DCV Calibration (DC/IR MODE)

- (1) Press [UP] or [DOWN] to select DCV offset calibration.
- (2) Connect a DC high voltage meter to HiPot tester.
- (3) Press [STOP][START] to read the high voltage meter value, ex. 0. 052kV.

DCV 6kV OFFSET (0.05kV)		60Hz	UP
OUTPUT	READING		DOWN
0.050kV	0.050kV		SETUP
STANDARD : 0.052kV			EXIT
	RMT	LOCK	OFST ERR

- (4) Press [INC.][DEC.] until shows 0.052kV and then press [ENTER] for saving.
- (5) Press [STOP] to stop DCV voltage offset calibration.
- (6) Press [UP] to change to the next calibration item.
- (7) Press [STOP][START] to read the high voltage meter value, ex. 4.052kV.

DCV 6kV FULL (4.0kV)	60Hz	UP
OUTPUT	READING	DOWN
4.000kV	4.000kV	SETUP
STANDARD : 4.052kV		EXIT
<div style="border: 1px solid black; display: inline-block; width: 150px; height: 15px;"></div> <div style="border: 1px solid black; display: inline-block; width: 40px; height: 15px; text-align: center;">RMT</div> <div style="border: 1px solid black; display: inline-block; width: 40px; height: 15px; text-align: center;">LOCK</div> <div style="border: 1px solid black; display: inline-block; width: 40px; height: 15px; text-align: center;">OFST</div> <div style="border: 1px solid black; display: inline-block; width: 40px; height: 15px; text-align: center;">ERR</div>		

- (8) Press [INC.] or [DEC.] until shows 4.052 kV and then press [ENTER] for saving.
- (9) Press [STOP] to stop DCV voltage full scale calibration.

4.2.4 IRV Calibration (DC/IR Mode)

- (1) Press [UP] or [DOWN] to select IRV offset calibration.
- (2) Connect a DC high voltage meter to HiPot tester.
- (3) Press [STOP][START] to read the high voltage meter value, ex. 0. 052kV.

IRV 1kV OFFSET (0.05kV)	60Hz	UP
OUTPUT	READING	DOWN
0.050kV	0.050kV	SETUP
STANDARD : 0.052kV		EXIT
<div style="border: 1px solid black; display: inline-block; width: 150px; height: 15px;"></div> <div style="border: 1px solid black; display: inline-block; width: 40px; height: 15px; text-align: center;">RMT</div> <div style="border: 1px solid black; display: inline-block; width: 40px; height: 15px; text-align: center;">LOCK</div> <div style="border: 1px solid black; display: inline-block; width: 40px; height: 15px; text-align: center;">OFST</div> <div style="border: 1px solid black; display: inline-block; width: 40px; height: 15px; text-align: center;">ERR</div>		


- (4) Press [INC.] or [DEC.] until shows 0. 052 kV and then press [ENTER] for saving.
- (5) Press [STOP] to stop IR voltage offset calibration.
- (6) Press [UP] to change to the next calibration item.
- (7) Press [STOP][START] to read the high voltage meter value, ex. 1.052kV.

IRV 1kV FULL (1.0kV)	60Hz	UP
OUTPUT	READING	DOWN
1.000kV	1.000kV	SETUP
STANDARD : 1.052kV		EXIT
<div style="border: 1px solid black; display: inline-block; width: 150px; height: 15px;"></div> <div style="border: 1px solid black; display: inline-block; width: 40px; height: 15px; text-align: center;">RMT</div> <div style="border: 1px solid black; display: inline-block; width: 40px; height: 15px; text-align: center;">LOCK</div> <div style="border: 1px solid black; display: inline-block; width: 40px; height: 15px; text-align: center;">OFST</div> <div style="border: 1px solid black; display: inline-block; width: 40px; height: 15px; text-align: center;">ERR</div>		

- (8) Press [INC.] or [DEC.] until shows 1.052 kV and then press [ENTER] for saving.
- (9) Press [STOP] to stop IR voltage full scale calibration.

4.3 Current Calibration

4.3.1 Connection Diagram

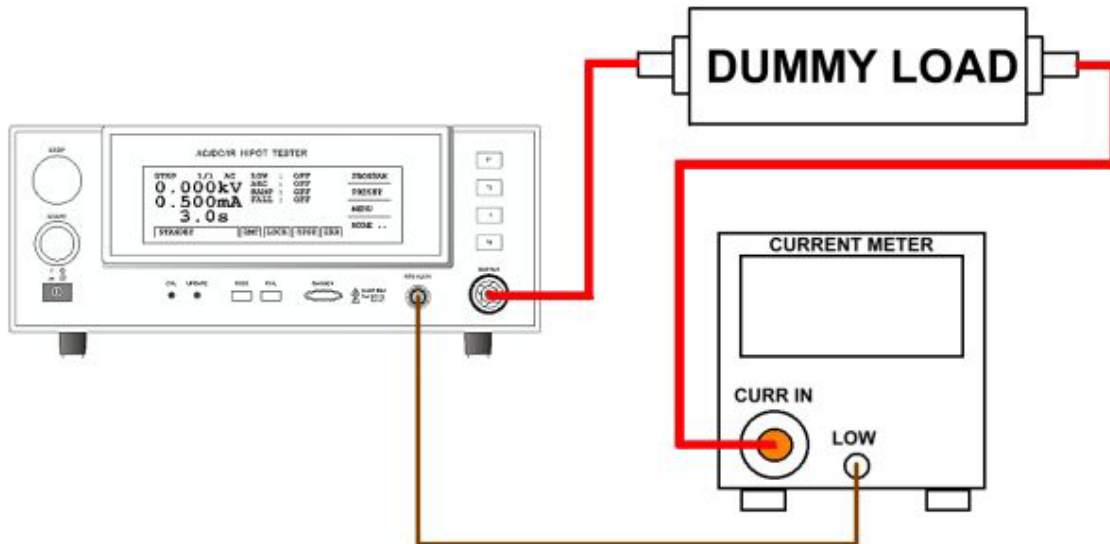

⚡ Caution

The dummy load connected to HiPot terminal contains high voltage. Be very careful with it as it may cause hazard.

4.3.2 ACA Calibration (AC MODE)

- Connect a dummy load resistor 10M Ω , 0.5 Watt or higher to the HiPot tester between high voltage output terminal and AC ammeter input high potential terminal. Connect the low potential terminal of HiPot tester to the low potential terminal of AC ammeter inputting.
 - (1) Press [UP] or [DOWN] to select ACA 3mA range offset calibration.
 - (2) Press [STOP][START] to read the ammeter value, ex. 0.124mA.

ACA 3mA OFFSET (0.12mA)				UP
OUTPUT		READING		DOWN
1.200kV		0.120mA		SETUP
STANDARD : 0.124mA				EXIT
LOAD = 10M Ω		LOCK	OFST	

- (3) Press [INC.] or [DEC.] until shows 0.124mA and then press [ENTER] for saving.
- (4) Press [STOP] to stop ACA 3.0mA range offset calibration.
- (5) Press [UP] to change to the next calibration item.

- (6) Change the dummy load resistor to 500k Ω 10watt or higher.
 (7) Press [STOP][START] to read the ammeter value, ex. 2.450mA.

ACV 3mA FULL (2.4mA)		60Hz	UP
OUTPUT	READING		DOWN
1.200kV	2.400mA		SETUP
STANDARD : 2.450kV			EXIT
LOAD=500k Ω	RMT	LOCK	OFST ERR

- (8) Press [INC.] or [DEC.] until shows 2.450mA and then press [ENTER] for saving.
 (9) Press [STOP] to stop ACA 3.0mA range full scale calibration.
 (10) Press [UP] to change to the next calibration item.
 (11) Press [STOP][START] to read the ammeter value, ex. 2.450mA.

ACA 20mA OFFSET (2.4mA)		60Hz	UP
OUTPUT	READING		DOWN
1.200kV	2.45mA		SETUP
STANDARD : 2.45mA			EXIT
LOAD=500k Ω	RMT	LOCK	OFST ERR

- (12) Press [INC.] or [DEC.] until shows 2.450mA and then press [ENTER] for saving.
 (13) Press [STOP] to stop ACA 20.0mA range offset calibration.
 (14) Press [UP] to change to the next calibration item.
 (15) Change the dummy load resistor to 100k Ω 50watt or higher.
 (16) Press [STOP][START] to read the ammeter value, ex. 12.20mA.

ACA 20mA FULL (12mA)		60Hz	UP
OUTPUT	READING		DOWN
1.200kV	12.00mA		SETUP
STANDARD : 12.20mA			EXIT
LOAD=100k Ω	RMT	LOCK	OFST ERR

- (17) Press [INC.] or [DEC.] until shows 12.20mA and then press [ENTER] for saving.
 (18) Press [STOP] to stop ACA 20.0mA range full scale calibration.

4.3.3 DCA Calibration (DC/IR MODE)

- Connect a dummy load resistor 10M Ω , 0.5 Watt or higher to HiPot tester between high voltage output terminal and DC ammeter input high potential terminal. Connect the low potential terminal of HiPot tester to the low potential terminal of DC ammeter inputting.

- Press [UP] or [DOWN] to select DCA 3mA range offset calibration.
- Press [STOP][START] to read the ammeter value, ex. 0.124mA.

DCA 3mA OFFSET (0.12mA)		60Hz	UP
OUTPUT	READING		DOWN
0.050kV	0.120mA		SETUP
STANDARD : 0.124mA			EXIT
LOAD=10M Ω	RMT	LOCK	OFST ERR


- Press [INC.] or [DEC.] until shows 0.124mA and then press [ENTER] for saving.
- Press [STOP] to stop DCA 3.0mA range offset calibration.
- Press [UP] to change to the next calibration item.
- Change the dummy load resistor to 500k Ω 10watt or higher.
- Press [STOP][START] to read the ammeter value, ex. 2.450mA.

DCV 3mA FULL (2.4mA)		60Hz	UP
OUTPUT	READING		DOWN
1.200kV	2.400mA		SETUP
STANDARD : 2.452mA			EXIT
LOAD=500k Ω	RMT	LOCK	OFST ERR

- Press [INC.] or [DEC.] until shows 2.450mA and then press [ENTER] for saving.
- Press [STOP] to stop DCA 3.0mA range full scale calibration.
- Press [UP] to change to the next calibration item.
- Press [STOP][START] to read the ammeter value, ex. 2.45mA.




- (12) Press [INC.] or [DEC.] until shows 2.45mA and then press [ENTER] for saving.
- (13) Press [STOP] to stop DCA 5.0mA range offset calibration.
- (14) Press [UP] to change to the next calibration item.
- (15) Change the dummy load resistor to 250kΩ 20watt or higher.
- (16) Press [STOP][START] to read the ammeter value, ex. 4.85mA.

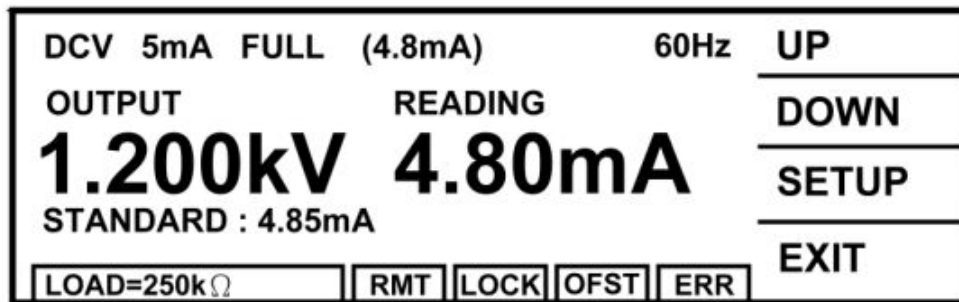

- (17) Press [INC.] or [DEC.] until shows 4.85mA and then press [ENTER] for saving.
- (18) Press [STOP] to stop DCA 5.0mA range full scale calibration.

4.4 ARC Calibration

4.4.1 Connection Diagram

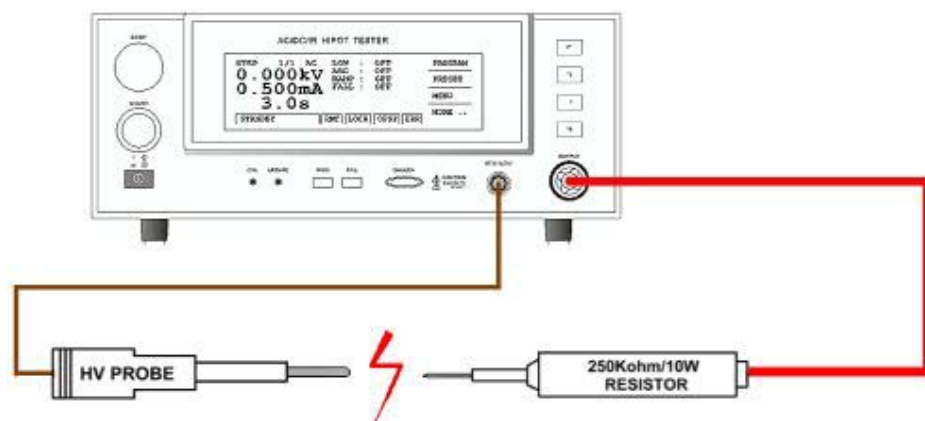

⚡ Caution

1. ARC calibration is very special, the high voltage terminal are in outside. Be careful with it as it may cause hazard.
2. Please contact your local agent for more detailed descriptions.

4.4.2 AC ARC Calibration (AC MODE)


- Connect one terminal of dummy load resistor 250kΩ, 5 Watt or higher to high voltage output terminal and get closer to low potential terminal of the HiPot tester gradually. However, do not connect the HiPot tester to another terminal of resistor and generate sparking between these two.
- (1) Press [UP] or [DOWN] to select AC ARC calibration.
 - (2) Press [SETUP] [READING] to enter ARC reading setting.
 - (3) Press [INC.] or [DEC.] until shows the reading is $(\text{OUTPUT}/\text{READING}) \times 1.414$, $((1.25\text{kV}/250\text{k}\Omega) \times 1.414) = 7.7\text{mA}$.

AC ARC 20mA (7mA)		60Hz	UP
OUTPUT	READING		DOWN
1.250kV	7.7mA		SETUP
STANDARD : 7.0mA			EXIT
LOAD=250kΩ	RMT	LOCK	OFST ERR

- (4) Press [RETURN] twice to exit ARC reading setting.
- (5) Press [STOP] [START] for starting test.
- (6) Press [INC.] or [DEC.] to adjust the low terminal of HiPot tester get closer to another terminal of the dummy load resistor gradually, and generate sparking between these two. The HiPot tester happens ARC fail.
- (7) Repeat step (5) – (6) until the sparking between these two is smaller, the HiPot tester still happens ARC fail.

4.4.3 DC ARC Calibration (DC MODE)


- Connect one terminal of dummy load resistor 250kΩ, 5 Watt or higher to the high voltage output terminal and get closer to low potential terminal of the HiPot tester gradually. However, do not connect the HiPot tester to another terminal of resistor and generate sparking between these two.
- (1) Press [UP] or [DOWN] to select DC ARC calibration.
 - (2) Press [SETUP] [READING] to enter ARC reading setting.
 - (3) Press [INC.] or [DEC.] until shows the reading is $(\text{OUTPUT}/\text{READING})$, $(0.75\text{kV}/250\text{k}\Omega) = 3\text{mA}$.

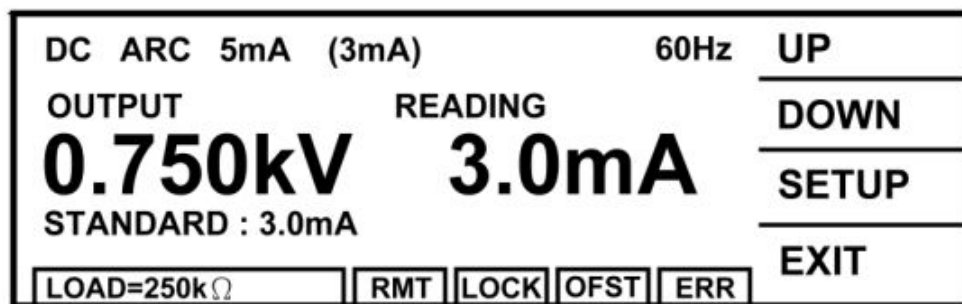

- (4) Press [RETURN] twice to exit ARC reading setting.
- (5) Press [STOP] [START] for starting test.
- (6) Press [INC.] or [DEC.] to adjust the low terminal of HiPot tester get closer to another terminal of the dummy load resistor gradually, and generate sparking between these two. The HiPot tester happens ARC fail.
- (7) Repeat step (5) – (6) until the sparking between these two is smaller, the HiPot tester still happens ARC fail.

4.5 IRR Calibration (IR Mode)

4.5.1 Connection Diagram

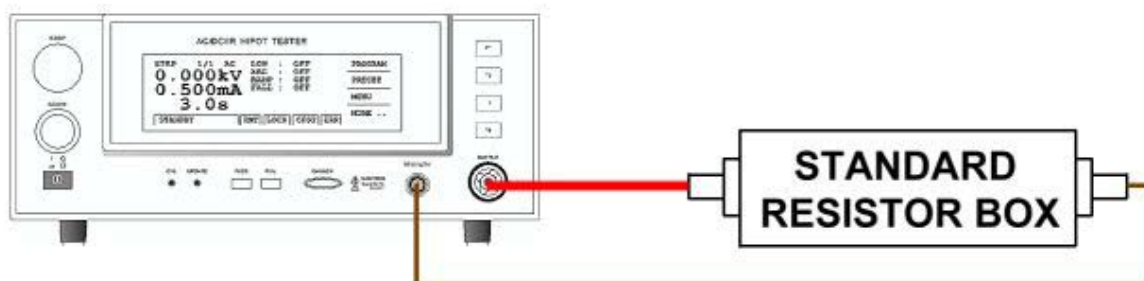

4.5.2 Insulation Resistance Calibration

- Connecting a standard dummy load resistor between the high voltage output terminal and low potential terminal of the Hi-Pot tester.

IRR Range1 (1000MΩ)	; the dummy load resistor is 1000MΩ.
IRR Range2 (100MΩ)	; the dummy load resistor is 100MΩ.
IRR Range3 (10MΩ)	; the dummy load resistor is 10MΩ.
IRR Range4 (10MΩ)	; the dummy load resistor is 10MΩ.

- (1) Press [UP] or [DOWN] to select IRR range 1 calibration.
- (2) To connect the standard dummy load resistor 1000MΩ.
- (3) Press [STOP] [START].
- (4) Press [INC.] or [DEC.] until shows the standard resistance value, ex. 1000MΩ and then press [ENTER] for saving.

IRR RANGE1 (1000M Ω)		60Hz	UP
OUTPUT	READING		DOWN
0.250kV	1000M Ω		SETUP
STANDARD : 1000M Ω			EXIT
LOAD=1000M Ω	RMT	LOCK	OFST ERR

- (5) Press [STOP] to stop IRR range 1 calibration.
- (6) Press [UP] to change to the next calibration item.
- (7) Change the standard dummy load resistor to 100M Ω .
- (8) Press [STOP] [START].
- (9) Press [INC.] or [DEC.] until shows the standard resistance value, ex. 100M Ω and then press [ENTER] for saving.


IRR RANGE2 (100M Ω)		60Hz	UP
OUTPUT	READING		DOWN
0.250kV	100M Ω		SETUP
STANDARD : 100.0M Ω			EXIT
LOAD=100M Ω	RMT	LOCK	OFST ERR

- (10) Press [STOP] to stop IRR range 2 calibration.
- (11) Press [UP] to change to the next calibration item.
- (12) Change the standard dummy load resistor to 10M Ω .
- (13) Press [STOP] [START].
- (14) Press [INC.] or [DEC.] until shows the standard resistance value, ex. 10M Ω and then press [ENTER] for saving.

IRR RANGE3 (10M Ω)		60Hz	UP
OUTPUT	READING		DOWN
0.250kV	10.0M Ω		SETUP
STANDARD : 10.0M Ω			EXIT
LOAD=10M Ω	RMT	LOCK	OFST ERR

- (15) Press [STOP] to stop IRR range 3 calibration.
- (16) Press [UP] to change to the next calibration item.
- (17) Press [STOP] [START].
- (18) Press [INC.] or [DEC.] until shows the standard resistance value, ex. 10M Ω and then


press [ENTER] for saving.

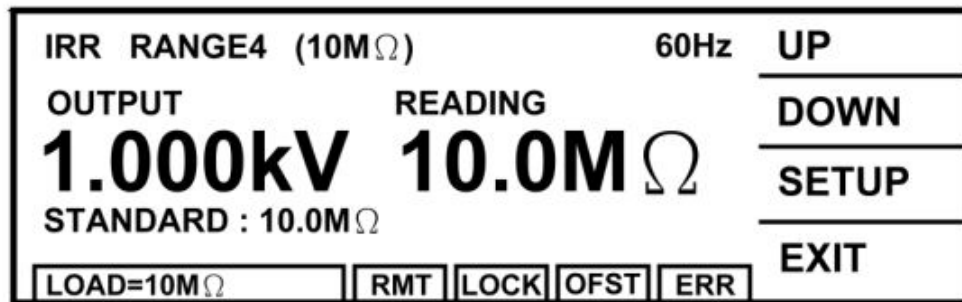

(19) Press [STOP] to stop IRR range 4 calibration.

4.6 Ground Continue Calibration

4.6.1 Connection Diagram

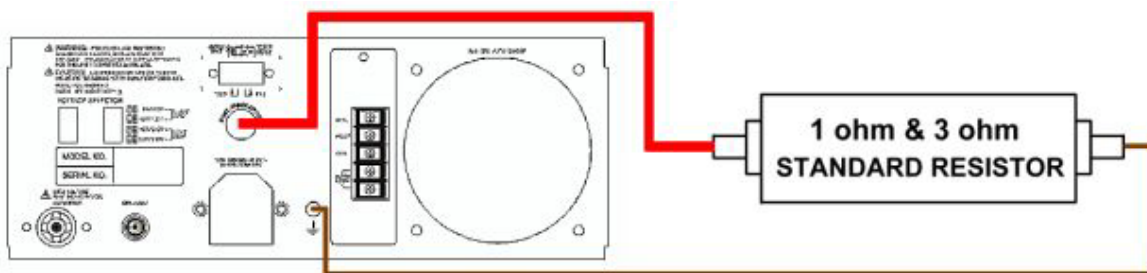

4.6.2 Description of Ground Continue Calibration

- Connect the standard dummy load resistor to the rear panel of HiPot tester which is between ground continue current output terminal and grounding terminal. Using the standard 1Ω and 3Ω 1/8 Watt dummy load resistors.

Preparing a standard 1Ω resistor.

- (1) Press [UP].
- (2) Connect resistor to ground and CONT.CHK OPTION terminal of rear panel.
- (3) Press [STOP][START] to read GC resistance value 1Ω.
- (4) Press [UP] or [DOWN] until the reading is the actual resistance value.

GC 5Ω OFFSET (1Ω)	60Hz	UP
OUTPUT	READING	DOWN
0.1A	1.0 Ω	SETUP
STANDARD : 1.0 Ω		EXIT
LOAD=1Ω	RMT	LOCK
OFST	ERR	

(5) Press [ENTER] for saving the calibration value.

(6) Press [STOP] to stop GC 5Ω Offset calibration.

Change the standard resistor to 3Ω.

(1) Press [UP].

(2) Connect resistor to ground and CONT.CHK OPTION terminal of rear panel.

(3) Press [STOP][START] to read GC resistance value 3Ω.

(4) Press [UP] or [DOWN] until the reading is the actual resistance value.

GC 5Ω FULL (3Ω)	60Hz	UP
OUTPUT	READING	DOWN
0.1A	3.0 Ω	SETUP
STANDARD : 3.0 Ω		EXIT
LOAD=3Ω	RMT	LOCK
OFST	ERR	

(5) Press [ENTER] for saving the calibration value.

(6) Press [STOP] to stop GC 5Ω Full calibration.

4.7 LCD Contrast Calibration

- After cleared the memory data, this calibration set LCD Contrast to the best suitable value.

(1) Press [UP] or [DOWN] to select LCD Contrast Calibration.

(2) Press [SETUP] to enter LCD Contrast setting.

(3) Press [INC.] or [DEC.] until the reading shows the best suitable brightness.

CAL. CONTRAST (7)		60Hz	UP
CONTRAST	CALIBRATION		DOWN
7	12		SETUP
			EXIT
1-15	RMT	LOCK	OFST
	ERR		

4.8 Complete Calibration


- Press [EXIT] to complete the calibration. Press the front panel calibration switch again for opening the hardware data backup protection circuit to avoid the calibration data loss.

5. RS485 Interface (For Link Model of 19073 + RS485)


If link model of 19073 + RS485 is purchased, please refer this chapter.

5.1 Description of Function

1. RS485 interface can connect multi-device, and it up to multi-device test synchronously through Master operation.

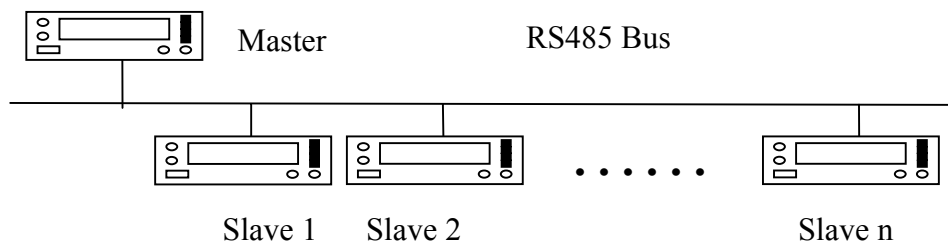

2. It is able to connect PC from this interface (PC includes RS485 interface). The PC is instead of Master for up to remote control function.

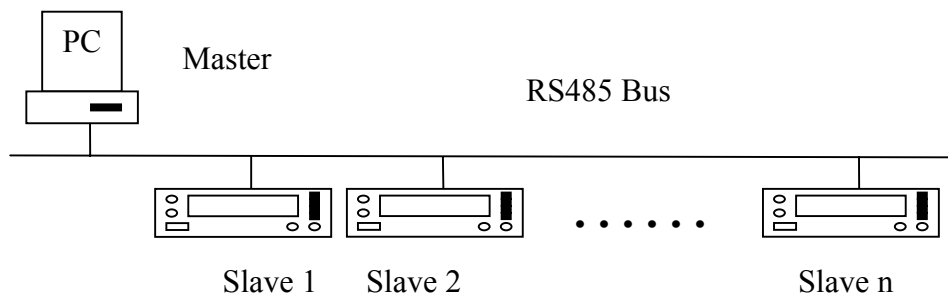

5.2 Parameter Setting

1. Press [MENU] under [STANDBY] screen, and by using [F1], [F2] to move the highlight to "OPTION" then press [SELECT]. Move the highlight to [REMOTE INTERFACE], press [SELECT] then can enter RS485 setting screen.
2. Use [NEXT] to move the highlight, and [UP], [DOWN] to switch the setting value.
3. Setting item descriptions:
 - a. INTERFACE: It selects if the RS485 interface existed or not.
 - b. UNIT TYPE: It selects the device is Master or Slave.
 - c. BAUD RATE: It selects the transmission rate is 4800, 9600 or 19200 baud rate.
 - d. SLAVE NUMBER (Master Only): When the tester is powered-on or test completed (selectable), Master will detect if address 1 to Slave communication is normal or not.
 - e. CHECK RESULT (Master Only): When CHECK RESULT ON, the rear panel

signal meanings of Master are as the following:

UNDER TEST signal: It means Slave in testing.

PASS signal: It means all Slave connections are normal and the test completed.

FAIL signal: It means Slave not complete the test, may be the connections abnormal.

① NOTE:

When CHECK RESULT ON, Master will not judge the test result of the DUT, thus Master can't connect the DUT.

4. SEND START (Master Only): It controls that Master receives [START] signal of front panel or rear panel, if it will send the signal to all Slaves through RS485 interface.



① NOTE:

When the tester power-on, before testing if Slave communication is normal, Master will switch Slave to Remote status in advance. When the test is completed, if this switch (SEND START) set as OFF then Master will switch Slave to Local status.

5. UNIT ADDRESS (Slave Only): It sets Slave address, the range is 1-31 (Master address is fixed on 32).


5.3 Terminal and Pin Signal Connection

RS485

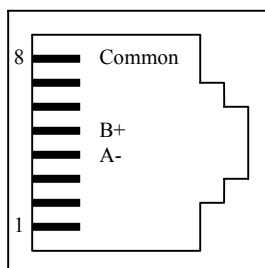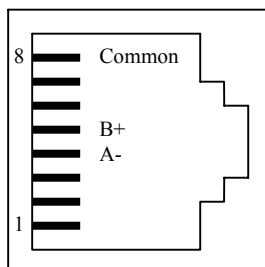


5.4 Communication Protocol


This interface uses half duplex of 2-wire system non-synchronized transmission mode.

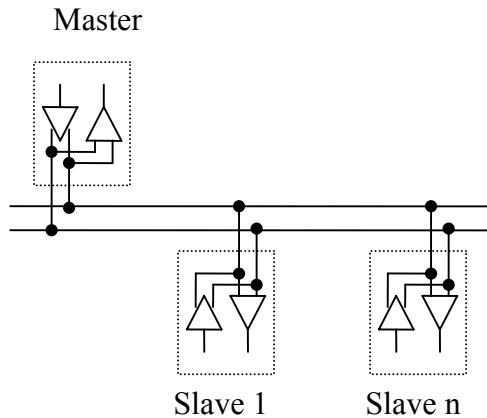

Before the bus control is transferred, please wait the time of two characters.

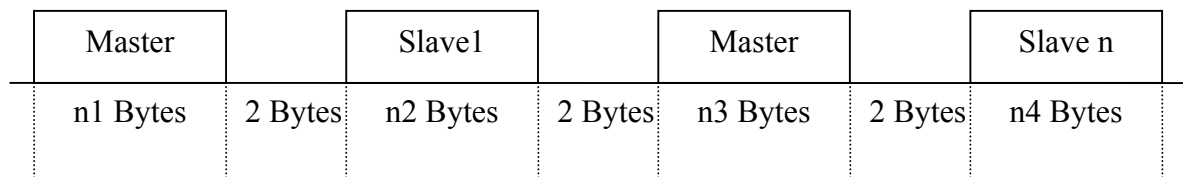

The transmission format of character is 1 initial bit, 8 data bits and 1 end bit, the total is 10 bits.

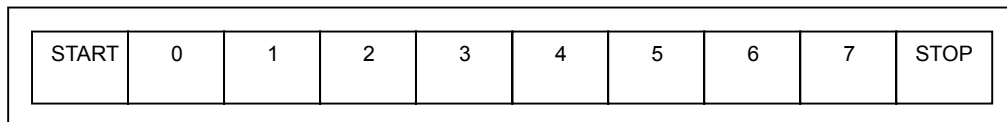

The receivers don't respond any data under broadcast mode. When the receivers receive the query functions under node-to-node transmission mode, it returns the relative data. However, the receivers receive the execution command, it returns the result of executing. About Reply Message, please refer the descriptions of command.

The commands are packed into packets, Data Frame as the following:

Header	DA	SA	Length	Data Field	Checksum
1 byte	1 byte	1 byte	1 byte	n bytes	1 byte

Header: 0xAB
Destination Address: 0x0 ~ 0x7F, 0xFF is broadcast address
Source Address: 0x0 ~ 0x7F
Data Field Length: It means the length of data field.
Data Field: Please refer the command set.

Command Code	Parameter
1 byte	0 ~ n-1 bytes

Checksum: Summing these values into two supplements, included data are
DA + SA + Length + Data Field

5.5 Command List

Commands	Code (Hex)
*IDN?	0x90
Display Address	0x20
Stop	0x21
Start	0x22
Offset Get/Off	0x23
Offset?	0xA3
Step Parameters	0x24
Step Parameters?	0xA4
Preset Parameters	0x25
Preset Parameters	0xA5
Store Memory	0x26
Recall Memory	0x27
Delete Memory	0x28
System Setting	0x29
System Setting?	0xA9
Key Lock	0x2A
Key Lock?	0xAA
Initialize All Steps Parameters	0x2C
Step Number?	0xAD
Remote/Local	0x2E
Remote?	0xAE
Set C Standard	0x2F
Result?	0xB1
Do Get C Standard	0x33
Reply Message	0x7F

5.6 Command Description

*IDN?

Description:	It queries the devices' identification and describes the string.
Command code:	0x90
Parameter:	None
Return data:	The format is "Company Name, Device Name, Device S/N, Firmware Version, Hold Field"
Example:	
Master (0x70):	0xAB 0x01 0x70 0x01 0x90 0xFE
Slave (0x01):	0xAB 0x70 0x01 0x16 0x90 0x43 0x48 0x52 0x4F 0x4D 0x41

0x2C 0x31 0x39 0x30 0x37 0x33 0x2C 0x30 0x2C 0x33 0x2E
0x31 0x31 0x2C 0x30 0x58

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header
0x01 = Destination Address
0x70 = Source Address
0x01 = Data Field Length
0x90 = Command Code
0xFE = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header
0x70 = Destination Address
0x01 = Source Address
0x16 = Data Field Length
0x90 = Command Code
0x43 0x48 0x52 0x4F 0x4E 0x4D 0x41 = "CHROMA" Company Name (return data)
0x2C = "," (return data)
0x31 0x39 0x30 0x37 0x33 = "19073" Device Name (return data)
0x2C = "," (return data)
0x30 = "0" Device S/N (return data)
0x2C = "," (return data)
0x33 0x2E 0x31 0x31 = "3.11" Firmware Version (return data)
0x2C = "," (return data)
0x30 = "0" Hold Field (return data)
0x58 = Checksum

Display Address

Description: It displays the device address.
Command code: 0x20
Parameter: None
Return data: Reply Message
Example: Master (0x70): 0xAB 0x01 0x70 0x01 0x20 0x6E
Slave (0x01): 0xAB 0x70 0x01 0x02 0x7F 0x00 0x0E

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header
0x01 = Destination Address
0x70 = Source Address
0x01 = Source Address
0x20 = Command Code
0x6E = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header
0x70 = Destination Address
0x01 = Source Address

0x02 = Source Address
0x7F = Reply Message Command Code
0x00 = Reply Message Return Data
0x0E = Checksum

Stop

Description: Stop test
Command code: 0x21
Parameter: None
Return data: Reply Message
Example: Master (0x70): 0xAB 0x01 0x70 0x01 0x21 0x6D
Slave (0x01): 0xAB 0x70 0x01 0x02 0x7F 0x00 0x0E

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header
0x01 = Destination Address
0x70 = Source Address
0x01 = Data Field Length
0x21 = Command Code
0x6D = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header
0x70 = Destination Address
0x01 = Source Address
0x02 = Data Field Length
0x7F = Reply Message Command Code
0x00 = Reply Message Return Data
0x0E = Checksum

Start

Description: Start test
Command code: 0x22
Parameter: None
Return data: Reply Message
Example: Master (0x70): 0xAB 0x01 0x70 0x01 0x22 0x6C
Slave (0x01): 0xAB 0x70 0x01 0x02 0x7F 0x00 0x0E

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header
0x01 = Destination Address
0x70 = Source Address
0x01 = Data Field Length
0x22 = Command Code
0x6C = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header
0x70 = Destination Address
0x01 = Source Address
0x02 = Data Field Length
0x7F = Reply Message Command Code
0x00 = Reply Message Return Data
0x0E = Checksum

Offset Get/Off

Description: It switches OFFSET status.
Command code: 0x23
Parameter: 1 byte, 0:OFF or 2:GET
Return data: Reply Message
Example: Master (0x70): 0xAB 0x01 0x70 0x02 0x23 0x02 0x68
Slave (0x01): 0xAB 0x70 0x01 0x02 0x7F 0x00 0x0E

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header
0x01 = Destination Address
0x70 = Source Address
0x02 = Data Field Length
0x23 = Command Code
0x02 = 2:GET (Command Parameter)
0x68 = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header
0x70 = Destination Address
0x01 = Source Address
0x02 = Data Field Length
0x7F = Reply Message Command Code
0x00 = Reply Message Return Data
0x0E = Checksum

Offset?

Description: It queries OFFSET status.
Command code: 0xA3
Parameter: None
Return data: 1 byte, 0: Off, 1:On or 2:Getting
Example: Master (0x70):0xAB 0x01 0x70 0x01 0xA3 0xEB
Slave (0x01): 0xAB 0x70 0x01 0x02 0xA3 0x00 0xEA

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header
0x01 = Destination Address
0x70 = Source Address

0x01 = Data Field Length
 0xA3 = Command Code
 0xEB = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header
 0x70 = Destination Address
 0x01 = Source Address
 0x02 = Data Field Length
 0xA3 = Command Code
 0x00 = 0: Off (Return Data)
 0xEA = Checksum

Step Parameters

Description: It sets all parameters of various steps.
 Command code: 0x24
 Parameter: 28 bytes

AC mode

Name	Size (byte)	Unit	Range	Description
Step index	1	-	1~10	Must less or equal original step number + 1
Mode	1	-	1	AC mode
Source	2	V	0, 50~5000	0:OFF
Ramp Time	2	100mS	0~9990	0:OFF
Reserved	2	-	0	Reserved
Test Time	2	100mS	0~9990	0:Continue
Fall Time	2	100mS	0~9990	0:OFF
High Limit	4	100nA	10~200000	
Low Limit	4	100nA	0, 10~200000	0:OFF
Arc Limit	4	100nA	0, 10000~200000	0:OFF
Reserved	4	-	0	Reserved

DC Mode

Name	Size (byte)	Unit	Range	Description
Step index	1	-	1~10	Must less or equal original step number + 1
Mode	1	-	2	DC mode
Source	2	V	0, 50~6000	
Ramp Time	2	100mS	0~9990	0:OFF
Dwell Time	2	100mS	0~9990	0:OFF
Test Time	2	100mS	0~9990	0:Continue
Fall Time	2	100mS	0~9990	0:OFF
High Limit	4	100nA	1~50000	
Low Limit	4	100nA	0~50000	0:OFF
Arc Limit	4	100nA	0, 10000~50000	0:OFF
Inrush Limit	4	100nA	0, 5~50000	0:OFF

IR Mode

Name	Size (byte)	Unit	Range	Description
Step index	1	-	1~10	Must less or equal original step number + 1
Mode	1	-	3	IR mode
Source	2	V	0, 50~1000	
Ramp Time	2	100mS	0~9990	0:OFF
Dwell Time	2	100mS	0~9990	0:OFF
Test Time	2	100mS	0, 3~9990	0:Continue

Fall Time	2	100mS	0~9990	0:OFF
High Limit	4	100kOhm	0~500000	0:OFF
Low Limit	4	100kOhm	1~500000	
Reserved	4	-	0	Reserved
Reserved	4	-	0	Reserved

GC Mode

Name	Size (byte)	Unit	Range	Description
Step index	1	-	1~10	Must less or equal original step number + 1
Mode	1	-	4	GC mode
Source	2	mA	0/100	
Reserved	2	-	0	Reserved
Dwell Time	2	100mS	1~10	
Reserved	2	-	0	Reserved
Reserved	2	-	0	Reserved
High Limit	4	100mOhm	1~50	
Low Limit	4	100mOhm	0~50	0:OFF
Reserved	4	-	0	Reserved
Reserved	4	-	0	Reserved

PA Mode (Pause mode)

Name	Size (byte)	Unit	Range	Description
Step index	1	-	1~10	Must less or equal original step number + 1
Mode	1	-	5	PA mode
UT Signal	2	-	1 or 2	(Under Test Signal) 1:Off, 2:On
Message	16	-		C String, maximum length is 15
Reserved	4	-	0	Reserved
Reserved	4	-	0	Reserved

OS Mode (OSC mode)

Name	Size (byte)	Unit	Range	Description
Step index	1	-	1~10	Must less or equal original step number + 1
Mode	1	-	6	OS mode
Source	2	V	100	Always 100V
Open Limit	2	10%	1~10	10% ~ 100%
Reserved	2	-	0	Reserved
Test Time	2	100mS	1	Always 100mS
Short Limit	2	100%	1~5	100% ~ 500%
C Standard	4	pF	0~120000	
Reserved	4	-	0	Reserved
Range	4	-	1~3	3 is maximum range
Reserved	4	-	0	Reserved

Return data: Reply Message

Example: Master (0x70): 0xAB 0x01 0x70 0x1D 0x24 0x01 0x01 0xE8 0x03
0x14 0x00 0x00 0x00 0x32 0x00 0x1E 0x00 0x10 0x27 0x00 0x00
0xE8 0x03 0x00 0x00 0x10 0x27 0x00 0x00 0x00 0x00 0x00 0x00
0xA4

Slave (0x01): 0xAB 0x70 0x01 0x02 0x7F 0x00 0x0E

Remark: When the length of data is larger than 1 character (byte), it is needed to send the minimum character in advance.

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header

0x01 = Destination Address
 0x70 = Source Address
 0x1D = Data Field Length
 0x24 = Command Code
 0x01 = Step1 (Command Parameter)
 0x01 = AC Mode (Command Parameter)
 0xE8 0x03 = Voltage 1000V (Command Parameter)
 0x14 0x00 = Ramp Time 2sec (Command Parameter)
 0x00 0x00 = Reserved (Command Parameter)
 0x32 0x00 = Test Time 5sec (Command Parameter)
 0x1E 0x00 = fall time 3sec (Command Parameter)
 0x10 0x27 0x00 0x00 = Hi Limit 1.000mA (Command Parameter)
 0xE8 0x03 0x00 0x00 = Low Limit 0.100mA (Command Parameter)
 0x10 0x27 0x00 0x00 = Arc Limit 1.000mA (Command Parameter)
 0x00 0x00 0x00 0x00 = Reserved (Command Parameter)
 0xA4 = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header
 0x70 = Destination Address
 0x01 = Source Address
 0x02 = Data Field Length
 0x7F = Reply Message Command Code
 0x00 = Reply Message Return Data
 0x0E = Checksum

Step Parameters?

Description: It queries all parameters of various steps.
 Command code: 0xA4
 Parameter: 1 byte, the serial number of step, the range is 1-10
 Return data: 28 bytes data
 Example: Master (0x70): 0xAB 0x01 0x70 0x02 0xA4 0x01 0xE8
 Slave (0x01): 0xAB 0x70 0x01 0x1D 0xA4 0x01 0x01 0x38 0x04
 0x1E 0x00 0x00 0x00 0x3C 0x00 0x09 0x00 0x0C
 0x17 0x00 0x00 0x90 0x01 0x00 0x00 0x20 0x4E
 0x00 0x00 0x00 0x00 0x00 0x00 0x0B

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header
 0x01 = Destination Address
 0x70 = Source Address
 0x02 = Data Field Length
 0xA4 = Command Code
 0x01 = Parameter
 0xE8 = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header

0x70 = Destination Address
 0x01 = Source Address
 0x1D = Data Field Length
 0xA4 = Command Code
 0x01 = Step1 (Return Data)
 0x01 = AC Mode (Return Data)
 0x38 0xE4 = Voltage 1080V (Return Data)
 0x1E 0x00 = Ramp Time 3sec (Return Data)
 0x00 0x00 = Reserved (Return Data)
 0x3C 0x00 = Test Time 6sec (Return Data)
 0x09 0x00 = Fall Time 0.9sec (Return Data)
 0x0C 0x17 0x00 0x00 = Hi Limit 0.590mA (Return Data)
 0x90 0x01 0x00 0x00 = Low Limit 0.040mA (Return Data)
 0x20 0x4E 0x00 0x00 = Arc Limit 2.000mA (Return Data)
 0x00 0x00 0x00 0x00 = Reserved (Return Data)
 0x0B = Checksum

Preset Parameters

Description: It sets all parameters of Preset.

Command code: 0x25

Parameter: 6 bytes

Name	Size (byte)	Unit	Range	Description
AC Frequency	1	Hz	50/60	
Software AGC	1	-	0/1	0:OFF, 1:ON
WV Auto Range	1	-	0/1	0:OFF, 1:ON
IR Auto Range	1	-	0/1	0:OFF, 1:ON
GFI(Ground Fault Interrupt)	1	-	0/1	0:OFF, 1:ON
Fail Restart	1	-	0/1	0:OFF, 1:ON
Screen	1	-	0/1	0:OFF, 1:ON

Return data: Reply Message

Example: Master (0x70): 0xAB 0x01 0x70 0x08 0x25 0x32 0x00 0x01 0x00
 0x01 0x01 0x00 0x2D

Slave (0x01): 0xAB 0x70 0x01 0x02 0x7F 0x00 0x0E

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header

0x01 = Destination Address

0x70 = Source Address

0x08 = Data Field Length

0x25 = Command Code

0x32 = ACV Frequency 50Hz

0x00 = Software AGC OFF

0x01 = WV Auto Range ON

0x00 = IR Auto Range OFF

0x01 = Ground Fault Interrupt (GFI) ON

0x01 = Fail Restart ON

0x00 = Screen OFF
0x2D = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header
0x70 = Destination Address
0x01 = Source Address
0x02 = Data Field Length
0x7F = Reply Message Command Code
0x00 = Reply Message Return Data
0x0E = Checksum

Preset Parameter?

Description: It queries all parameters of Preset.
Command code: 0xA5
Parameter: None
Return data: 6 bytes
Example: Master (0x70): 0xAB 0x01 0x70 0x01 0xA5 0xE9
Slave (0x01): 0xAB 0x70 0x01 0x08 0xA5 0x3C 0x01 0x00 0x01
0x01 0x00 0x01 0xA2

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header
0x01 = Destination Address
0x70 = Source Address
0x01 = Data Field Length
0xA5 = Data Field Length
0xE9 = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header
0x70 = Destination Address
0x01 = Source Address
0x07 = Data Field Length
0xA5 = Command Code
0x3C = ACV Frequency 60Hz (Return Data)
0x01 = Software AGC ON (Return Data)
0x00 = WV Auto Range OFF (Return Data)
0x01 = IR Auto Range ON (Return Data)
0x01 = Ground Fault Interrupt (GFI) ON
0x00 = Fail Restart OFF (Return Data)
0x01 = Screen ON
0xA2 = Checksum

Store Memory

Description: It saves the parameters of various steps and Preset to the internal memory.
Command code: 0x26

Parameter: Serial number of memory + Name of memory. The length of serial number of memory is 1 character. The range is 1 ~ 60, the name length of the memory is 0 ~ 10 character.

Return data: Reply Message

Example: Master (0x70): 0xAB 0x01 0x70 0x08 0x26 0x01 0x43 0x48 0x52
0x4F 0x4D 0x41 0xA6
Slave (0x01): 0xAB 0x70 0x01 0x02 0x7F 0x00 0x0E

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header
0x01 = Destination Address
0x70 = Source Address
0x08 = Data Field Length
0x26 = Command Code
0x01 = Memory S/N

0x43 0x48 0x52 0x4F 0x4D 0x41 = "CHROMA" Memory Name
(Command Parameter)
0xA6 = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header
0x70 = Destination Address
0x01 = Source Address
0x02 = Data Field Length
0x7F = Reply Message Command Code
0x00 = Reply Message Return Data
0x0E = Checksum

Recall Memory

Description: It recalls the saved test steps from various device internal memories.

Command code: 0x27

Parameter: 1 byte, serial number of memory, the range is 1 ~ 60

Return data: Reply Message

Example: Master (0x70): 0xAB 0x01 0x70 0x02 0x27 0x01 0x65
Slave (0x01): 0xAB 0x70 0x01 0x02 0x7F 0x00 0x0E

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header
0x01 = Destination Address
0x70 = Source Address
0x02 = Data Field Length
0x27 = Command Code
0x01 = "01" Memory S/N (Command Parameter)
0x65 = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header

0x70 = Destination Address

0x01 = Source Address

0x02 = Data Field Length

0x7F = Reply Message Command Code

0x00 = Reply Message Return Data

0x0E = Checksum

Delete Memory

Description: It deletes the saved test steps from the memories inside device.

Command code: 0x28

Parameter: 1 byte, serial number of memory, the range is 0 ~ 60. When the parameter is 0, it means it is need to clear the working memory, this includes all steps and Preset parameters.

Return data: Reply Message

Example: Master (0x70): 0xAB 0x01 0x70 0x02 0x28 0x01 0x64

Slave (0x01): 0xAB 0x70 0x01 0x02 0x7F 0x00 0x0E

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header

0x01 = Destination Address

0x70 = Source Address

0x02 = Data Field Length

0x28 = Command Code

0x01 = "01" Memory S/N (Command Parameter)

0x64 = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header

0x70 = Destination Address

0x01 = Source Address

0x02 = Data Field Length

0x7F = Reply Message Command Code

0x00 = Reply Message Return Data

0x0E = Checksum

System Setting

Description: It sets the system parameter.

Command code: 0x29

Parameter: 4 bytes

Name	Size (byte)	Unit	Range	Description
Contrast	1	-	1~15	
Buzzer Volume	1	-	0/1/2/3	0:OFF, 1:Low, 2:Medium, 3:High
EN50191	1	-	0/1	0:OFF, 1:ON (AC maximum is 3mA)
DC 50V AGC	1	-	0/1	0:OFF, 1:ON
Pass On	1	100mS	0 ~ 100	0:OFF
END OF STEP	1	-	0/1	0:OFF, 1:ON

Return data: Reply Message

Example: Master (0x70): 0xAB 0x01 0x70 0x07 0x29 0x0A 0x03 0x00 0x00
0x00 0x00 0x54
Slave (0x01): 0xAB 0x70 0x01 0x02 0x7F 0x00 0x0E

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header
0x01 = Destination Address
0x70 = Source Address
0x05 = Data Field Length
0x29 = Command Code
0x0A = Contrast 10 (Command Parameter)
0x03 = Buzzer Volume High (Command Parameter)
0x00 = EN50191 OFF (Command Parameter)
0x00 = DC 50V AGC OFF (Command Parameter)
0x00 = PASS ON OFF (Command Parameter)
0x00 = END OF STEP OFF (Command Parameter)
0x52 = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header
0x70 = Destination Address
0x01 = Source Address
0x02 = Data Field Length
0x7F = Reply Message Command Code
0x00 = Reply Message Return Data
0x0E = Checksum

System Setting?

Description: It queries the system parameter.

Command code: 0xA9

Parameter: None

Return data: 4 bytes

Example:

Master (0x70): 0xAB 0x01 0x70 0x01 0xA9 0xE5

Slave (0x01): 0xAB 0x70 0x01 0x07 0xA9 0x08 0x01 0x01 0x01 0x00 0x00 0xD4

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header
0x01 = Destination Address
0x70 = Source Address
0x01 = Data Field Length
0xA9 = Command Code
0xE5 = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header
0x70 = Destination Address
0x01 = Source Address
0x07 = Data Field Length
0xA9 = Command Code
0x08 = Contrast 8 (Return Data)
0x01 = Buzzer Volume Low (Return Data)
0x01 = EN50191 ON (Return Data)
0x01 = DC 50V AGC ON (Return Data)
0x00 = PASS ON OFF (Command Parameter)
0x00 = END OF STEP OFF (Command Parameter)
0xD6 = Checksum

Key Lock

Description: It switches KEY LOCK status.
Command code: 0x2A
Parameter: 1 byte
0: key board lock OFF, recall key lock OFF
1: key board lock ON, recall key lock OFF
2: key board lock ON, recall key lock ON
Return data: Reply Message
Example: Master (0x70): 0xAB 0x01 0x70 0x02 0x2A 0x01 0x62
Slave (0x01): 0xAB 0x70 0x01 0x02 0x7F 0x00 0x0E

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header
0x01 = Destination Address
0x70 = Source Address
0x02 = Data Field Length
0x2A = Command Code
0x01 = "01"key board lock ON, recall key lock (Command Parameter)
0x62 = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header
0x70 = Destination Address
0x01 = Source Address
0x02 = Data Field Length
0x7F = Reply Message Command Code
0x00 = Reply Message Return Data

0x0E = Checksum

Key Lock?

Description: It queries KEY LOCK status.

Command code: 0xAA

Parameter: None

Return data: 1 byte data

0: key board lock OFF, recall key lock OFF

1: key board lock ON, recall key lock OFF

2: key board lock ON, recall key lock ON

Example: Master (0x70): 0xAB 0x01 0x70 0x01 0xAA 0xE4

Slave (0x01): 0xAB 0x70 0x01 0x02 0xAA 0x01 0xE2

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header

0x01 = Destination Address

0x70 = Source Address

0x01 = Data Field Length

0xAA = Command Code

0xE4 = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header

0x70 = Destination Address

0x01 = Source Address

0x02 = Data Field Length

0xAA = Command Code

0x01 = "01"Key Board Lock ON, Recall Key Lock OFF (Return Data)

0xE2 = Checksum

Initialize All Steps Parameters

Description: It sets all steps to the initial setting, this command will delete all steps.

Command code: 0x2C

Parameter: None

Return data: Reply Message

Example: Master (0x70): 0xAB 0x01 0x70 0x01 0x2C 0x62

Slave (0x01): 0xAB 0x70 0x01 0x02 0x7F 0x00 0x0E

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header

0x01 = Destination Address

0x70 = Source Address

0x01 = Data Field Length

0x2C = Command Code

0x62 = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header
0x70 = Destination Address
0x01 = Source Address
0x02 = Data Field Length
0x7F = Reply Message Command Code
0x00 = Reply Message Return Data
0x0E = Checksum

Step Number?

Description: It queries the step numbers of being set.
Command code: 0xAD
Parameter: None
Return data: 1 byte data
Example: Master (0x70): 0xAB 0x01 0x70 0x01 0xAD 0xE1
Slave (0x01): 0xAB 0x70 0x01 0x02 0xAD 0x05 0xDB

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header
0x01 = Destination Address
0x70 = Source Address
0x01 = Data Field Length
0xAD = Command Code
0xE1 = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header
0x70 = Destination Address
0x01 = Source Address
0x02 = Data Field Length
0xAD = Command Code
0x05 = "05" the step numbers of being set (Return Data)
0xDB = Checksum

Remote/Local

Description: It switches the device to remote or local control.
Command code: 0x2E
Parameter: 1 byte
0: Go to Local.
1: Go to Remote.
2: Go to Remote and Local Lockout
Return data: Reply Message
Example: Master (0x70): 0xAB 0x01 0x70 0x02 0x2E 0x01 0x5E
Slave (0x01): 0xAB 0x70 0x01 0x02 0x7F 0x00 0x0E

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header
0x01 = Destination Address

0x70 = Source Address
0x02 = Data Field Length
0x2E = Command Code
0x01 = "1"Go to Remote (Command Parameter)
0x5E = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header
0x70 = Destination Address
0x01 = Source Address
0x02 = Data Field Length
0x7F = Reply Message Command Code
0x00 = Reply Message Return Data
0x0E = Checksum

Remote Status?

Description: It queries remote status of the device.
Command code: 0xAE
Parameter: None
Return data: 1 byte data
0: Local
1: Remote
2: Remote and Local Lockout
Example: Master (0x70): 0xAB 0x01 0x70 0x01 0xAE 0xE0
Slave (0x01): 0xAB 0x70 0x01 0x02 0xAE 0x01 0xDE

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header
0x01 = Destination Address
0x70 = Source Address
0x01 = Data Field Length
0xAE = Command Code
0xE0 = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header
0x70 = Destination Address
0x01 = Source Address
0x02 = Data Field Length
0xAE = Command Code
0x01 = "1" Remote (Return Data)
0xDE = Checksum

Set C Standard

Description: It sets the standard capacitance of OS mode.
Command code: 0x2F
Parameter: 6 byte

Name	Size (byte)	Unit	Range	Description
Step Index	1	-	1~10	
C Standard	4	pF	0~120000	
Range	1	-	1~3	3 is maximum range

Return data: Reply Message

Example: Master (0x70): 0xAB 0x01 0x70 0x07 0x2F 0x01 0x00 0x04 0x00 0x00 0x01 0x53
Slave (0x01): 0xAB 0x70 0x01 0x02 0x7F 0x00 0x0E

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header
0x01 = Destination Address
0x70 = Source Address
0x07 = Data Field Length
0x2F = Command Code
0x01 = Step Index 1(setting data)
0x00 0x04 0x00 0x00 = C Standard 1024pF(setting data)
0x01 = Range 1(setting data)
0x53 = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header
0x70 = Destination Address
0x01 = Source Address
0x02 = Data Field Length
0x7F = Reply Message Command Code
0x00 = Reply Message Return Data
0x0E = Checksum

Result?

Description: It queries the test result and measurement value.

Command code: 0xB1

Parameter: 2 bytes, serial numbers of steps + items of measurement values, the range of serial numbers of steps is 0 ~ 10. When the range is 0, it means to query the last one which starts to perform or the step which be performed completely. According to the weight of 2 to divide the measurement value option into 8 items, if queries multi-item simultaneously, the lesser weight is sent at first.

The measurement value option:

AC mode

Item Number	Name	Size (byte)	Unit	Description
1	Mode	1	-	1:AC Mode
2	Meter 1 (Source)	2	V	30000: Maximum, 31000: Not Value
4	Meter 2 (Current)	4	100nA	1000000000: Maximum, 1100000000: Not Value
8	Meter 3	4	-	Reserved
16	Ramp Time	2	100mS	30000: Maximum, 31000: Not Value
32	Reserved	2	-	Reserved
64	Test Time	2	100mS	30000: Maximum, 31000: Not Value

128	Fall Time	2	100mS	30000: Maximum, 31000: Not Value
-----	-----------	---	-------	----------------------------------

DC mode

Item Number	Name	Size (byte)	Unit	Description
1	Mode	1	-	2:DC Mode
2	Meter 1 (Source)	2	V	30000: Maximum, 31000: Not Value
4	Meter 2 (Current)	4	100nA	1000000000: Maximum, 1100000000: Not Value
8	Meter 3 (Inrush)	4	100nA	1000000000: Maximum, 1100000000: Not Value
16	Ramp Time	2	100mS	30000: Maximum, 31000: Not Value
32	Dwell Time	2	100mS	30000: Maximum, 31000: Not Value
64	Test Time	2	100mS	30000: Maximum, 31000: Not Value
128	Fall Time	2	100mS	30000: Maximum, 31000: Not Value

IR mode

Item Number	Name	Size (byte)	Unit	Description
1	Mode	1	-	3:IR Mode
2	Meter 1 (Source)	2	V	30000: Maximum, 31000: Not Value
4	Meter 2 (Resistance)	4	100kOhm	1000000000: Maximum, 1100000000: Not Value
8	Meter 3	4	-	Reserved
16	Ramp Time	2	100mS	30000: Maximum, 31000: Not Value
32	Dwell Time	2	100mS	30000: Maximum, 31000: Not Value
64	Test Time	2	100mS	30000: Maximum, 31000: Not Value
128	Fall Time	2	100mS	30000: Maximum, 31000: Not Value

GC mode

Item Number	Name	Size (byte)	Unit	Description
1	Mode	1	-	4:GC Mode
2	Meter 1 (Source)	2	mA	30000: Maximum, 31000: Not Value
4	Meter 2 (Resistance)	4	100mOhm	1000000000: Maximum, 1100000000: Not Value
8	Meter 3	4	-	Reserved
16	Reserved	2	-	Reserved
32	Dwell Time	2	100mS	30000: Maximum, 31000: Not Value
64	Reserved	2	-	Reserved
128	Reserved	2	-	Reserved

PA mode

Item Number	Name	Size (byte)	Unit	Description
1	Mode	1	-	5:PA Mode
2	Under Test Signal	2	-	1:Off, 2:On
4, 8, 16, 32, 64 or 128	Message	16	-	C String, maximum length is 15

OS mode

Item Number	Name	Size (byte)	Unit	Description
1	Mode	1	-	6:OS Mode
2	Meter 1 (Source)	2	V	30000: Maximum, 31000: Not Value
4	Meter 2 (capacitance)	4	pF	1000000000: Maximum, 1100000000: Not Value
8	Reserved	4	-	Reserved
16	Reserved	2	-	Reserved
32	Reserved	2	-	Reserved
64	Test Time	2	100mS	30000: Maximum, 31000: Not Value
128	Reserved	2	-	Reserved

Return data: The flag of new test result (1 byte) + serial number of step (1 byte) + test result (1 byte) + measurement value option (1 byte) [+ measurement

value 1 + measurement value 2 + ...]

The flag is with new test result: it is the correct flag that can judge the measurement result. This flag set as ON when the test is initiated, and set as OFF when the test is stopped. Alternatively, the test is ended and the result is read by this command, then set as OFF. Thus, only in the test duration, the test completed or uses this command to read first time, this flag is ON otherwise is OFF.

Return test result codes:

Mode Code	AC		DC		IR		GC		OS		ALL	
	HEX	DEC	HEX	DEC	HEX	DEC	HEX	DEC	HEX	DEC	HEX	DEC
STOP											70	112
USER INTERRUPT											71	113
CAN NOT TEST											72	114
TESTING											73	115
PASS											74	116
SKIP											75	117
GFI FAIL											79	121
HIGH FAIL	11	17	21	33	31	49	41	65				
SHORT FAIL									61	97		
LOW FAIL	12	18	22	34	32	50	42	66				
OPEN FAIL									62	98		
ARC FAIL	13	19	23	35								
I/O FAIL	14	20	24	36	34	52			64	100		
NO OUTPUT	15	21	25	37	35	53						
VOLTAGE OVER	16	22	26	38	36	54			66	102		
CURRENT OVER	17	23	27	39	37	55			67	103		
INRUSH FAIL			28	40								

Example: The test results of devices:

Master (0x70): 0xAB 0x01 0x70 0x03 0xB1 0x00 0xD7 0x04

Slave (0x01): 0xAB 0x70 0x01 0x12 0xB1 0x01 0x01 0x74 0xD7 0x01
0x63 0x00 0x5A 0x00 0x00 0x00 0x0F 0x00 0x1E 0x00
0x18 0x00 0x7C

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header

0x01 = Destination Address

0x70 = Source Address

0x03 = Data Field Length

0xB1 = Command Code

0x00 = "00" It queries the last step that begins to execute or have been executed.
(Command Parameter)

0xD7 = "D7" Item Number (Command Parameter)

0x04 = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header

0x70 = Destination Address

0x01 = Source Address
0x12 = Data Field Length
0xB1 = Command Code
0x01 = New test result (Return Data)
0x01 = Step1 (Return Data)
0x74 = Test result code "PASS" (Return Data)
0xD7 = Item number (Return Data)
0x01 = AC mode (Return Data)
0x63 0x00 = Display Volt 0.099kV (Return Data)
0x5A 0x00 0x00 0x00 = Curr 0.009mA (Return Data)
0x0F 0x00 = ramp time 1.5sec (Return Data)
0x1E 0x00 = test time 3.0sec (Return Data)
0x18 0x00 = fall time 2.4sec (Return Data)
0x7C = Checksum

Note:

When the tester is pause mode, the data field length of returning may be different from other modes.

Do Get C Standard

Description: It enables the standard capacitance get function of OS mode.

Command code: 0x33

Parameter: None

Return data: Reply Message

Example: Master (0x70): 0xAB 0x01 0x70 0x01 0x33 0x5B

Slave (0x01): 0xAB 0x70 0x01 0x02 0x7F 0x00 0x0E

Descriptions of example

The setting meanings of HEX inputs are as the following:

0xAB = Header

0x01 = Destination Address

0x70 = Source Address

0x01 = Data Field Length

0x33 = Command Code

0x5B = Checksum

The reading meanings of returning HEX code are as the following:

0xAB = Header

0x70 = Destination Address

0x01 = Source Address

0x02 = Data Field Length

0x7F = Reply Message Command Code

0x00 = Reply Message Return Data

0x0E = Checksum

Reply Message

Description: It queries the performed result of previous command.

Command code: 0x7F

Parameter: None

Return data: 1 byte
 0 – OK, no error
 1 – Command Error (Include Execution Error)
 2 – Parameter Error

Example: Master(0x70): 0xAB 0x01 0x70 0x01 0x7F 0x0F
 Slave (0x01): 0xAB 0x70 0x01 0x02 0x7F 0x00 0x0E

Descriptions of example

Inputted setting meanings of HEX are as the following:


0xAB = Header
0x01 = Destination Address
0x70 = Source Address
0x01 = Data Field Length
0x7F = Command Code
0x0F = Checksum

The reading meanings of returning HEX code are as the following:


0xAB = Header
0x70 = Destination Address
0x01 = Source Address
0x02 = Data Field Length
0x7F = Command Code
0x00 = “00”OK, no error (Return Data)
0x0E = Checksum

5.7 Flow Diagram


1. Confirm if all of Slaves' communication is normal or not:

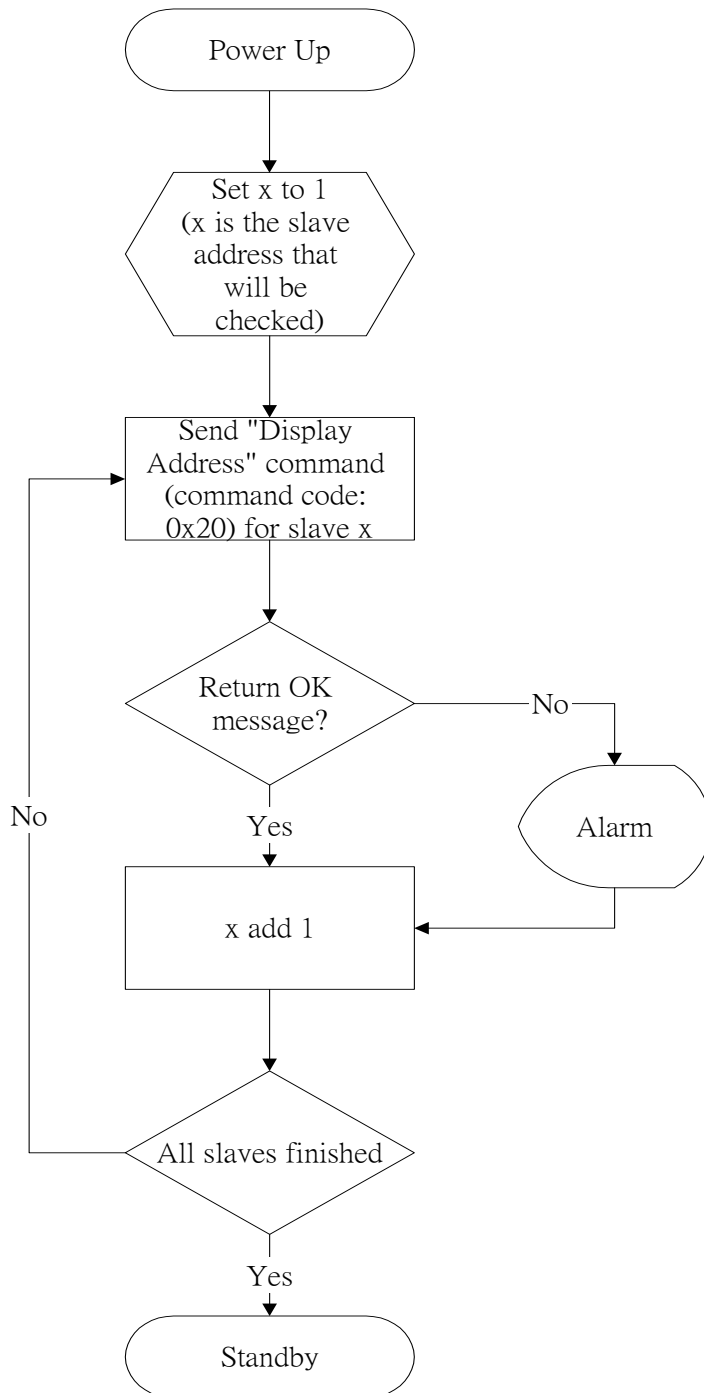

2. Upload the test steps from one slave then download to all slaves.

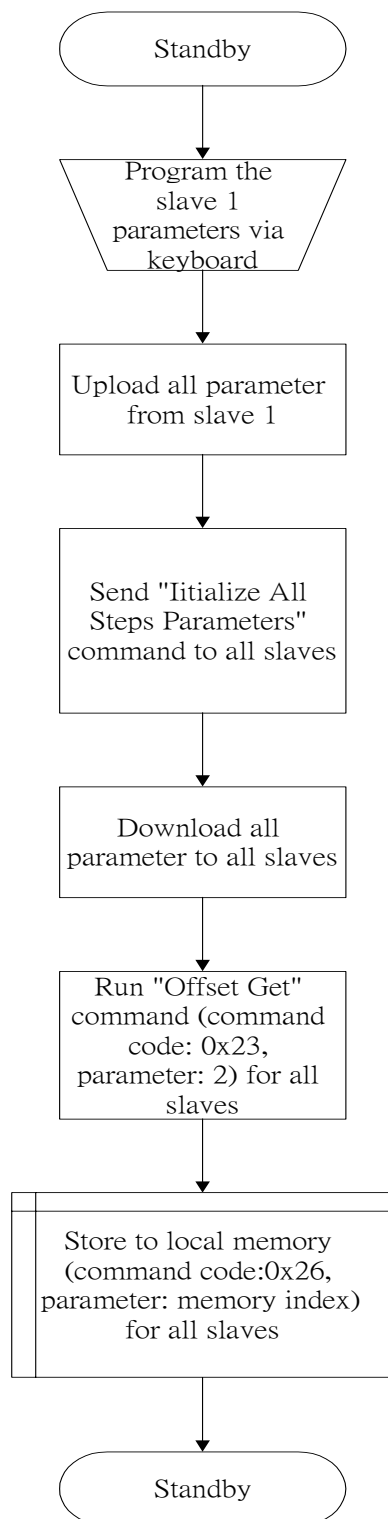

3. Read the measurement data:

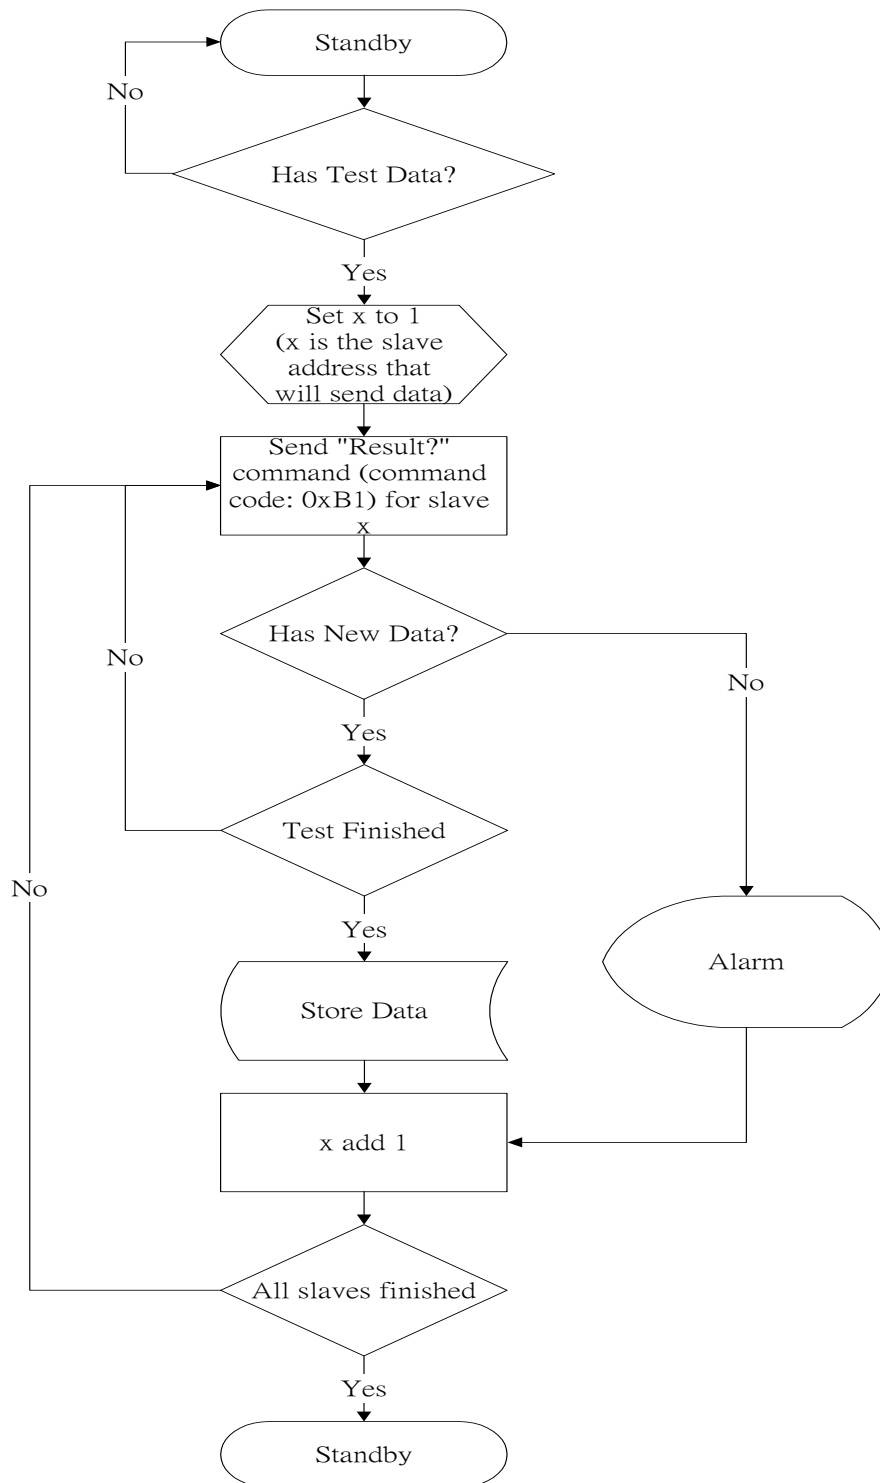

6. Maintenance

6.1 General

Our warranty (at the front of the manual) attests the quality of materials and workmanship in our products. If malfunction should be suspected, or other information be desired applications engineers are available for technical assistance. Application assistance is available in Taiwan by calling 886-3-3279999 and asking for applications support. For support outside of Taiwan please contact your local Chroma distributor.

6.2 Instrument Return

Before returning an instrument to Chroma for service please call our Service Department at 886-3-3279688 for return material authorization. It will be necessary to include a purchase order number to ensure expedient processing, although units found to be in warranty period will be repaired at no-charge. For any questions on repair costs or shipment instructions please contact our service department at the above number. To safeguard an instrument during storage and shipping please use packaging that is adequate to protect it from damage, i.e., equivalent to the original packaging and mark the box "Delicate Electronic Instrument". Return material should be sent freight prepaid, to:

**Chroma Ate Inc.
66 Hwa-Ya 1 Rd., Hwa-Ya Technical Park,
Kuei-Shan Hsiang, Taoyuan Hsien, Taiwan
Attention: Service Department**